

Contractor



Project

# FORTH REPLACEMENT CROSSING

Document title

# AIR QUALITY MONITORING REPORT MARCH 2017

00	11/04/2017	First revision	SWR	DCK	DCK
Rev	Rev. Date	Purpose of revision	Made	Checked	Reviewed

Document status

#### FOR REVIEW

REP-00317			00	
Document number			Rev	
Initials: SWR	Initials:	David Clark		
Made by Steven Westwater	Checked By: David Clark			

This document is intellectual property of FCBC Construction JV. Copying, distribution, usage, and information on contents of this are forbidden unless explicitly authorized.



#### **Distribution**

Name	Email Address	Copy Sent (Y/N)
Michael Martin	Michael.martin@fcbcjv.co.uk	



#### **Contents**

- 1. Introduction
- 2. Monitoring Equipment and Locations
- 3. Air Quality Monitoring Results
  - 3.1. Automatic Light Scatter Meter Particulate Matter Monitoring Results
  - 3.2. Total Suspended Particle Results
  - 3.3. Frisbee Dust Deposition Results
  - 3.4. Daily Dust Log and Weekly Environmental Inspections

#### **Appendices:**

**Appendix A: Particulate Matter Results** 

Appendix B: Total Suspended Particle Results

**Appendix C: Frisbee Dust Deposition Results** 

**Appendix D: Daily Dust Log Summary** 



#### 1. INTRODUCTION

- 1.1. Air quality monitoring is being undertaken by FCBC during the construction of the Forth Replacement Crossing and the associated road network. This report details the air quality monitoring that is currently being undertaken across the site and presents the monitoring results for March 2017.
- 1.2. Air quality monitoring during this period has been undertaken in accordance with the Code of Construction Practice (CoCP) and the Dust and Air Quality Management Plan (DAQMP) contained within the Environmental Management Plan (EMP).



#### 2. MONITORING EQUIPMENT AND LOCATIONS

- 2.1. Air quality is being monitored on site using both automatic light scatter dust meters and Frisbee gauge dust deposition monitoring. Twelve Frisbee gauges are currently set up at sensitive locations across the site to measure dust deposition rates (Figure 1). Seven automatic light scatter meters have also been installed at various sensitive locations to measure real time particulate matter (PM<sub>10</sub>) concentrations and the Total Suspended Particle (TSP) concentrations (Figure 2). These meters are calibrated annually. Table 1 lists the air quality monitoring equipment present at each monitoring location, including the date it was installed.
- 2.2. Light scatter type monitoring equipment have been selected as a site monitoring tool to create a live network which assesses the levels of fugitive particulate matter, principally airborne dust. These monitors require less space, maintenance and power than other real time monitors such as a Tapered Element Oscillating Microbalance (TEOM) which is used and designed to measure particulate levels to exceedingly high standards, including measuring long-term compliance to statutory limits. Light scatter meters are more practicable to deploy. However, the meters do generally record levels higher than those measured by the TEOM. The meters can also be affected by atmospheric moisture content which further increases reported levels. Accordingly, any elevations of statutory limits should be treated as precautionary exceedances. The monitors are reliable for on-site monitoring and the establishment of action thresholds to ensure unforeseen activities generating significant dust are identified and suitably controlled. Light scatter meters are becoming the construction and waste industries norm for particulate dust monitoring.



- 2.3. In association with air quality monitoring across the site, temperature and relative humidity are also continually measured by the light scatter meters at Inchgarvie Lodge and Clufflat Brae. Weather stations, located at the sound level meters at Echline, Linn Mill and Whinnyhill (these are adjacent to the light scatter meters at these monitoring locations), record weather data including; temperature, relative humidity, wind speed and wind direction.
- 2.4. In addition to the fixed monitoring equipment used at sensitive locations across the site, a daily dust log for both the North and South sites has been kept by the FCBC Environmental Department. This daily dust inspection is used to identify any dust occurring as a result of construction works and to determine if any actions are required. This log also provides a visual record of the weather conditions at the time of the inspection, including conditions that can affect readings, such as fog.
- **2.5.** Frequent environmental site inspections are also undertaken by members of the FCBC Environmental Department. These inspections include a dust check to assess the following:
  - dust levels on site;
  - suppression/dampening down; and
  - transportation of materials.



DRAGADOS | AMERICAN BRIDGE INTERNATIONAL HOCHTIEF | MORRISON CONSTRUCTION



Figure 1: Example of an Installed Frisbee Gauge Meter



Figure 2: Example of an installed Automatic Light Scatter Dust Meter



DRAGADOS | AMERICAN BRIDGE INTERNATIONAL HOCHTIEF | MORRISON CONSTRUCTION

#### **Table 1: Air Quality Monitoring Locations**

Ref:	Monitoring Location	Monitoring Equipment	Installation Date	Construction Activities in March
		Frisbee	21/03/12	Earthworks/Fill Placement
M1   Whinny Hill		Automatic light scatter meter 16/02/12		<ul><li>Bridge works at Ferrytoll</li><li>Main carriageway roadworks</li></ul>
M7	Butlaw Fisheries	Frisbee	05/10/11	<ul> <li>AVS concrete works</li> <li>Waterproofing on deck</li> <li>Wind shield installation</li> <li>Scour protection</li> <li>Stay cable installation works</li> <li>Bridge deck works</li> </ul>
M8	Barracks West	Frisbee	31/08/11	<ul> <li>AVS concrete works</li> <li>Waterproofing on deck</li> <li>Wind shield installation</li> <li>Scour protection</li> <li>Stay cable installation works</li> <li>Bridge deck works</li> </ul>
	Inchgarvie Lodge	Frisbee	22/08/11	<ul><li>Minor main carriageway works</li><li>SUDS detention basin works</li><li>AVS concrete works on deck</li></ul>
M10		Automatic light scatter meter	17/10/11	<ul> <li>Waterproofing on deck</li> <li>Wind shield installation</li> <li>Scour protection</li> <li>Stay cable installation works</li> <li>Bridge deck works</li> <li>South abutment works</li> </ul>
		Frisbee		<ul><li>Minor main carriageway works</li><li>SUDS detention basin works</li><li>AVS concrete works on deck</li></ul>
M11	Linn Mill	Automatic light scatter meter	06/12/11	<ul> <li>Waterproofing on deck</li> <li>Wind shield installation</li> <li>Scour protection</li> <li>Stay cable installation works</li> <li>Bridge deck works</li> <li>South abutment works</li> </ul>
M12	Clufflat	Frisbee	29/08/11	Minor main carriageway works
		Frisbee	21/09/11	SUDS detention basin works     AVS concrete works on deck
M13	Clufflat Brae	Automatic light scatter meter	24/10/11	<ul> <li>Waterproofing on deck</li> <li>Wind shield installation</li> <li>Scour protection</li> <li>Stay cable installation works</li> <li>Bridge deck works</li> </ul>



DRAGADOS | AMERICAN BRIDGE INTERNATIONAL HOCHTIEF | MORRISON CONSTRUCTION

				South abutment works
M14	Springfield	Frisbee	15/08/11	<ul> <li>Minor main carriageway works</li> <li>SUDS detention basin works</li> <li>AVS concrete works on deck</li> <li>Waterproofing on deck</li> <li>Wind shield installation</li> <li>Scour protection</li> <li>Stay cable installation works</li> <li>Bridge deck works</li> <li>South abutment works</li> </ul>
M15	Echline	Frisbee	16/08/11	Minor main carriageway works
		Automatic light scatter meter	10/11/11	
		Frisbee	07/09/11	Maria
M16 Scotstoun		Automatic light scatter meter	14/02/12	<ul><li>Main carriageway works</li><li>South-bound bus link</li></ul>
		Frisbee	29/08/11	
M17	Dundas Home Farm	Automatic light scatter meter	23/02/12	Main carriageway works
1446	NI 4	Frisbee	22/08/11	
M18	Newton	TEOM	23/05/12	None

#### 3. AIR QUALITY MONITORING RESULTS

#### 3.1. Automatic Light Scatter Dust Meter Monitoring Results

3.1.1. Light scatter results for March 2017 have been presented in a monthly chart; this can be found in Appendix A. Results show that the PM<sub>10</sub> levels follow a similar pattern and were below threshold levels throughout the month with the exception of the 28<sup>th</sup> - 29<sup>th</sup> March, where some monitors showed an exceedance. As all monitors recorded a significant increase over the same time period, it is concluded that these exceedances were caused by regional air quality. The Scotstoun



DRAGADOS | AMERICAN BRIDGE INTERNATIONAL HOCHTIEF | MORRISON CONSTRUCTION

monitor also showed an increase on the 24<sup>th</sup> and 25<sup>th</sup> March, with the 24<sup>th</sup> showing a minor exceedance. After investigation, the only work being undertaken near the monitor was the infrequent movement of site vehicles using the access track down the Southbound Public Transport Link, which may have caused a small quantity of dust. The environmental team will continue to monitor this situation and use a water bowser if dust is observed.

3.1.2. The PM<sub>10</sub> results have also been compared to the daily mean results obtained from the TEOM air quality monitoring stations located in Newton, Rosyth, and Broxburn, and from the TEOM FDMS station located at Queensferry Road and St Leonards, Edinburgh (an urban background site). The TEOM at Newton was installed by West Lothian Council, facilitated by FCBC, during January 2012. The comparison between the light scatter and TEOM results demonstrates that both sets of results generally follow the same pattern throughout the month, including during the time period of the exceedances noted in 3.1.1.

#### 3.2. Total Suspended Particles

**3.2.1.** The TSP results for March 2017 have been presented in a monthly chart; this can be found in Appendix B. The TSP levels at monitoring locations during March were found to be generally low and all within the threshold. All locations across the site were found to follow a similar pattern (similar to that observed for PM<sub>10</sub> levels), with the most notable increase occurring between 28t<sup>th</sup> and 29<sup>th</sup> March. As with PM<sub>10</sub> it is considered that the TSP levels across site were influenced by regional changes in TSP levels.

#### 3.3. Frisbee Dust Deposition Results

3.3.1. The Frisbee dust deposition results for March 2017 have been presented in a chart and can be found in Appendix C. Two collections were made in March; these occurred on the 8<sup>th</sup> and 22<sup>nd</sup> March 2017.



DRAGADOS | AMERICAN BRIDGE INTERNATIONAL HOCHTIEF | MORRISON CONSTRUCTION

- **3.3.2.** The site action level for the dust deposition rate has been set at 250 mg/m²/day. Exceedances of this level are treated as a potential incident and a review of the works in the vicinity of the site is instigated. A lower site review level has been set at 140 mg/m²/day. Where concentrations exceed the lower review threshold the site works are reviewed to ensure good practice is implemented; it is essentially a warning that additional controls may be required.
- **3.3.3.** During March there were no exceedances of either the site review or action levels.


#### 3.4. Daily Dust Log and Environmental Inspections

- **3.4.1.** A summary of the daily dust log for March can be found in Appendix D.
- **3.4.2.** During this period, full environmental inspections were also undertaken across the site and covered areas where works were being carried out.




**APPENDIX A: LIGHT SCATTER METER RESULTS** 



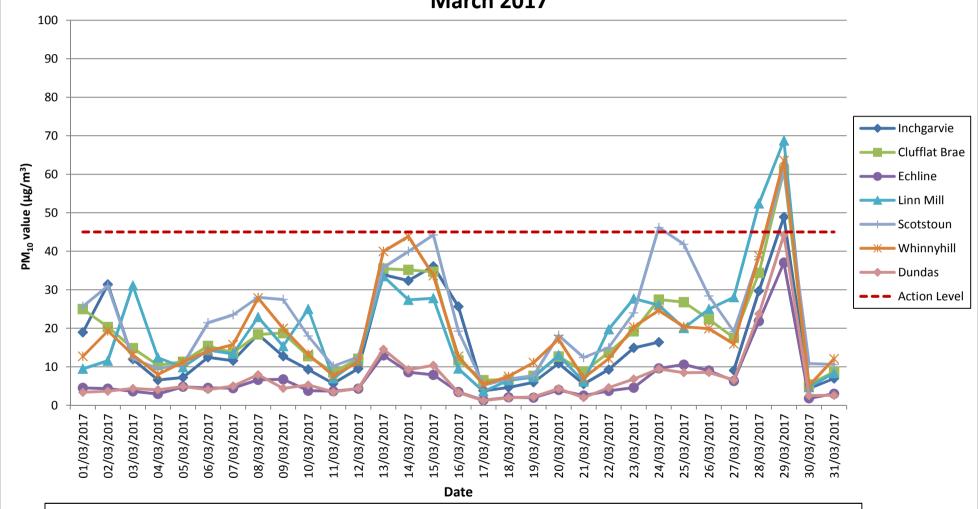

**Note**: There is no data at the Inchgarvie monitor between 25/03/2017 and 26/03/2017 due to a electrical problem at the monitor.


# Air Quality Monitoring: Particulate Matter (PM10) Results for all Monitoring Locations, inlcuding TEOM data March 2017

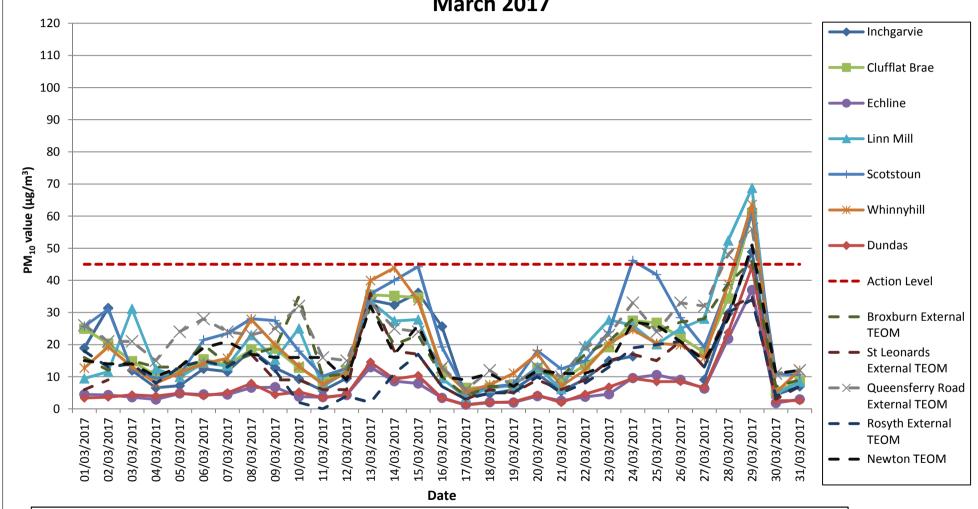

**Note**: There is no data at the Inchgarvie monitor between 25/03/2017 and 26/03/2017 due to a electrical problem at the monitor.




**APPENDIX B: TOTAL SUSPENDED PARTICLES** 

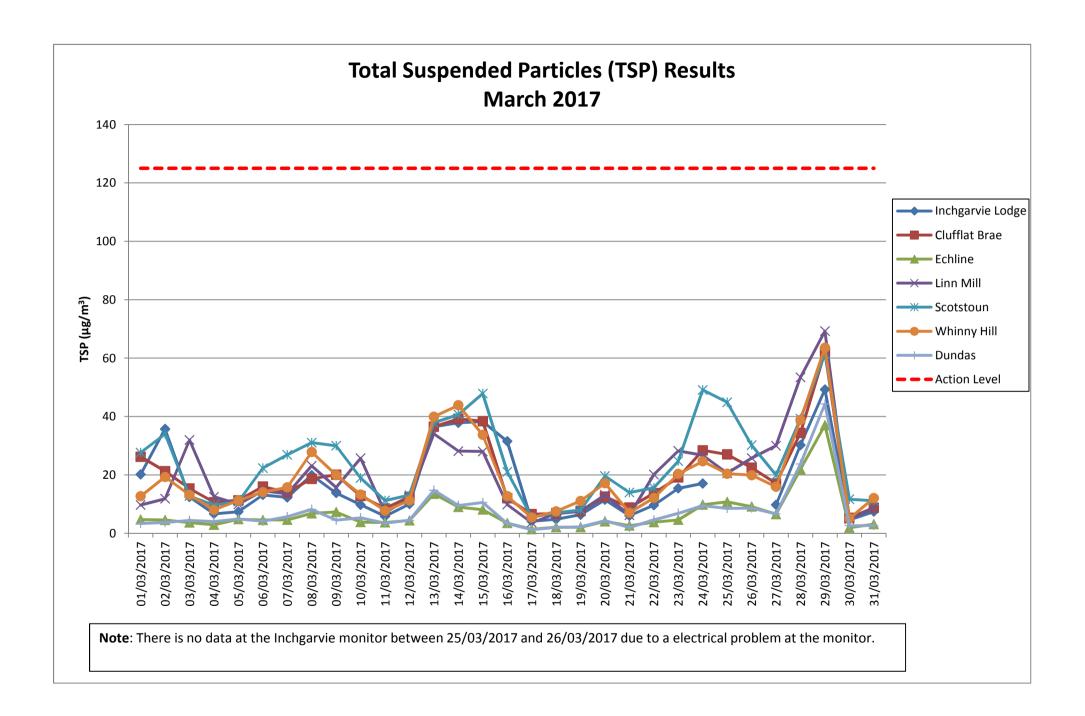



**APPENDIX C: FRISBEE GAUGE RESULTS** 

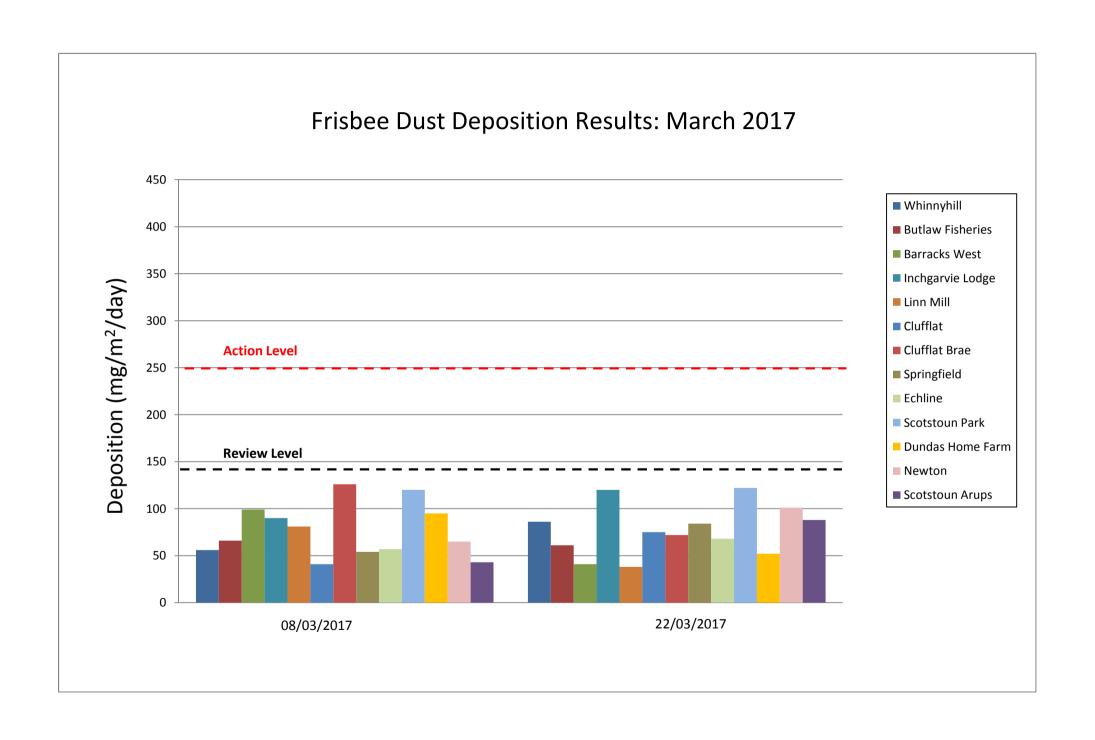



**APPENDIX D: DAILY DUST LOG** 

## Daily Dust Log - North - March 2017

DATE	LOCATION	WIND	WIND DIRECTION	GROUND SURFACE	VISIBLE DUST	DUST DUE TO WORKS (if applicable)	CAUSES OF DUST (if applicable)	COMMENTS AND ACTIONS
01/03/2017	N	LIGHT	SW	DRY	N			
02/03/2017	N	LIGHT	SW	DAMP	N			
03/03/2017	N	LIGHT	E	DRY	N			
04/03/2017								
05/03/2017								
06/03/2017	N	LIGHT	S	DRY	N			
07/03/2017	N	LIGHT	SE	WET	N			
08/03/2017	N	MEDIUM	E	WET	N			
09/03/2017	N	LIGHT	S	DRY	N			
10/03/2017	N	LIGHT	SE	DRY	N			
11/03/2017								
12/03/2017								
13/03/2017	N	LIGHT	Е	DRY	N			
14/03/2017	N	LIGHT	Е	DRY	N			
15/03/2017	N	LIGHT	S	DRY	N			
16/03/2017	N	LIGHT	SE	WET	N			
17/03/2017	N	LIGHT	SE	DRY	N			
18/03/2017								
19/03/2017								
20/03/2017	N	LIGHT	SE	WET	N			
21/03/2017	N	LIGHT	SE	WET	N			
22/03/2017	N	LIGHT	S	WET	N			
23/03/2017	N	LIGHT	S	DAMP	N			
24/03/2017	N	LIGHT	SE	DRY	N			
25/03/2017								
26/03/2017								
27/03/2017	N	LIGHT	SW	DRY	N			
28/03/2017	N	LIGHT	W	DAMP	N			
29/03/2017	N	LIGHT	SW	DRY	N			
30/03/2017	N	LIGHT	E	DRY	N			
31/03/2017	N	LIGHT	E	DRY	N			

## Daily Dust Log - South - March 2017

DATE	LOCATION	WIND	WIND DIRECTION	GROUND SURFACE	VISIBLE DUST	DUST DUE TO WORKS (if applicable)	CAUSES OF DUST (if applicable)	COMMENTS AND ACTIONS
01/03/2017	S	LIGHT	SW	DRY	Ν			
02/03/2017	S	LIGHT	SW	DAMP	Ν			
03/03/2017	S	LIGHT	NE	DRY	N			
04/03/2017								
05/03/2017								
06/03/2017	S	LIGHT	S	DRY	N			
07/03/2017	S	LIGHT	S	WET	N			
08/03/2017	S	MEDIUM	SE	WET	N			
09/03/2017	S	LIGHT	S	DRY	N			
10/03/2017	S	LIGHT	SE	DRY	Ν			
11/03/2017								
12/03/2017								
13/03/2017	S	LIGHT	Е	DRY	N			
14/03/2017	S	LIGHT	Е	DRY	Ν			
15/03/2017	S	LIGHT	SE	DRY	Ν			
16/03/2017	S	LIGHT	SE	WET	N			
17/03/2017	S	LIGHT	SE	DRY	N			
18/03/2017								
19/03/2017								
20/03/2017	S	LIGHT	SE	WET	N			
21/03/2017	S	LIGHT	SE	WET	N			
22/03/2017	S	LIGHT	S	WET	N			
23/03/2017	S	LIGHT	W	DAMP	Ν			
24/03/2017	S	LIGHT	S	DRY	N			
25/03/2017								
26/03/2017								
27/03/2017	S	LIGHT	SW	DRY	N			
28/03/2017	S	LIGHT	W	DAMP	N			
29/03/2017	S	LIGHT	SW	DRY	N			
30/03/2017	S	LIGHT	Е	DRY	N			
31/03/2017	S	LIGHT	Е	DRY	N			