



Contractor



Forth Crossing Bridge Constructors

- HOCHTIEF Solutions
- American Bridge International
- DRAGADOS
- Morrison Construction

Project **FORTH REPLACEMENT CROSSING**

Document title

CONSTRUCTION NOISE MONITORING REPORT: OCTOBER 2015

Rev	Rev. Date	Purpose of revision	Made	Checked	Approved
00	05/11/2015	First Revision	SWR	MRN	MRN

Document status

FOR REVIEW

Made by: Steven Westwater	Checked By: Michael Richardson
Initials: SWR	Initials: MRN

Document number	Rev
REP-00256	00

This document is intellectual property of FCBC Construction JV. Copying, distribution, usage, and information on contents of this are forbidden unless explicitly authorized.

Contents

- 1. Introduction**
- 2. Noise Monitoring Locations**
- 3. Noise Monitoring Results**

1 Introduction

- 1.1** Monitoring of construction noise is being undertaken by FCBC during the construction of the new Forth Crossing and the associated road network. This report covers the month of October 2015. The objective of this report is to detail the monitoring that was undertaken across the site during this reporting period and to present the construction noise monitoring results.
- 1.2** Monitoring of construction noise has been undertaken in accordance with the Code of Construction Practice (CoCP) and the Noise and Vibration Management Plan (NVMP).

2 Noise Monitoring Locations

- 2.1 During October 2015, construction noise was monitored using permanent, continuous noise monitoring devices (01db DUOs) at locations listed in **Table 1**. These monitors were installed during November and December 2011, with additional monitors installed at Scotstoun Park (Arup's Office) and Newton during March 2012, a further sound level meter was installed at Whinny Hill during April 2012.
- 2.2 Weather stations accompany the noise monitors at Echline Field, Tigh-Na-Grian, Clufflat Brae, Dundas Home Farm, Butlaw Fisheries, Linn Mill and Whinny Hill.
- 2.3 Various construction works were undertaken across the site during October 2015. **Table 1** outlines the main construction activities in the location of each monitor.

Table 1: Monitoring Locations

Ref.	Monitoring Location	Crossing or Network	Main Construction Activities During October 2015
M1	Whinny Hill	Network	<ul style="list-style-type: none"> • Earth Works/Fill Placement • New Ferrytoll Road • FT03 & FT04 Bridge Works • FT09 Works • FT19 Works • Roadworks
M3	Tigh-Na-Grian	Crossing	<ul style="list-style-type: none"> • Central Tower rebar, formwork, concreting works, deck lifting & stay cable installation works • North Tower rebar, formwork, concreting works, deck lifting and stay cable installation works • Pier N1 rebar formwork & concrete works • AVN works • North Tower deck section lifts and stay cable installation
M4	North Leg	Crossing	<ul style="list-style-type: none"> • Central Tower rebar, formwork, concreting works stay cable installation works • North Tower rebar, formwork, concreting works, deck section lifts and stay cable installation works. • Pier N1 rebar formwork & concrete works • North Tower deck section lifts and stay cable installation
M6	Port Edgar	• Crossing	<ul style="list-style-type: none"> • Central Tower rebar, formwork, concreting works, deck section lifts and stay cable installation works • South Tower rebar, formwork, concreting works, deck section lifts and stay cable installation works. • Pier S2 rebar, formwork & concrete works • Pier S1 rebar, formwork & concrete works
M7	Butlaw Fisheries	Crossing	<ul style="list-style-type: none"> • Pier S1, rebar, formwork & concrete works • Pier S2 rebar, formwork and concrete work • Central Tower rebar, formwork, concreting works, deck section lifts and stay cable installation works • South Tower rebar, formwork, concreting works, deck section lifts and stay cable installation works
M10	Inchgarvie Lodge	Crossing	<ul style="list-style-type: none"> • AVS ,Scaffolding,shuttering and reinforcement to deck • Pier S1, rebar, formwork & concrete works. • Central Tower rebar, formwork, concreting works ,deck section lifts and stay cable installation works. • South Tower rebar, formwork, concreting works, deck section lifts and stay cable installation works. • South Tower Deck Section Lifts

			<ul style="list-style-type: none"> • Main carriageway earthworks
M11	Linn Mill	Network (close proximity to Crossing)	<ul style="list-style-type: none"> • AVS scaffolding, shuttering and reinforcement to deck • No night time or Sunday construction in the vicinity • Main carriageway earthworks
M13	Clufflat Brae	Crossing / Network	<ul style="list-style-type: none"> • AVS scaffolding, shuttering and reinforcement to deck • No night time or Sunday construction in the vicinity • Main carriageway earthworks
M14	Springfield	Network	<ul style="list-style-type: none"> • AVS scaffolding, shuttering and reinforcement to deck • No night time or Sunday construction in the vicinity • Main carriageway earthworks
M15	Echline	Network	<ul style="list-style-type: none"> • AVS scaffolding, shuttering and reinforcement to deck • No night time or Sunday construction in the vicinity • Main carriageway earthworks
M16	Scotstoun	Network	<ul style="list-style-type: none"> • Footpath works • Utility works • B800 Piling works • B800 North road works including bridge works (these works are directly in the location of the meter which now sits within the construction boundary). • B800 Bridge Demolition • SB bus link
M17	Dundas Home Farm	Network	<ul style="list-style-type: none"> • Utility works • B800 piling works • B800 South road works including bridge works etc... • Main carriageway works • B800 Bridge Demolition • SB bus link
M18	Newton	Network	<ul style="list-style-type: none"> • No works

3 Noise Monitoring Results

Overview

3.1 Noise monitoring results are presented in graphs (**Appendix A**) using the template provided in the *Construction Noise Monitoring Information Note* (www.transportscotland.gov.uk).

3.2 With regard to the noise monitoring graphs, the following should be noted:

- All locations are considered as either 'Main Crossing' or 'Network Connections', as set out in **Table 1**.
- Main Crossing works are undertaken during the day, evening and night time periods. Network connection works are undertaken during the daytime only.
- Linn Mill is considered as a network location which has the potential to receive noise from the marine works near the south shore. As a result, evening and night time data has been included for this location.
- Noise data for day, evening and night on which no construction works were conducted have been excluded from the monthly average results presented in the graph. L_{AFmax} exceedances during these periods would have been caused by non-construction related factors and do not require investigation. Noise results (L_{Aeq} and L_{AFmax}) for any day, evening and night on which no construction works have been conducted have been presented in the graphs in greyed out areas.
- An average for Sunday construction noise data has been included where applicable; in locations where no Sunday works were conducted no average is shown.
- As set out in the CoCP, the assessment time for evening, nights and Sunday daytime is in one hour periods. To present the construction noise results for these periods, therefore, the maximum L_{AFmax} (fast time response) and maximum L_{Aeq} within the overall evening/night time period has been taken. It should be noted, therefore, that the average shown for these periods is an average of only the highest L_{Aeq} results.
- It has been indicated on the graphs, where noise data is missing for day, evening or night-time, during which construction works were conducted. Results for the North leg were unavailable during this reported period due to the monitor being calibrated.

Results

- 3.3** Results demonstrate that the monthly average total of construction noise results for daytime are within the threshold levels for all monitoring locations during October 2015. For evening and night time periods, there were no exceedances of monthly average construction noise during October, with the exception of Butlaw during the night-time periods. There are no exceedances of Sunday averages, with the exception of Inchgarvie during the day.
- 3.4** The rises in daytime exceedances at Scotstoun are likely to be due to the very close proximity of construction to the monitoring location. The works are very similar to previous works in the vicinity and construction noise levels at residential receptors were unlikely to be higher than before. No complaints were received from any of the residents in the location of the works during this period. There was a construction related exceedance at Scotstoun on the 1st, 6th, 8th, 9th, 10th, 13th, 23rd and 27th October
- 3.5** The exceedances noted are not thought to have been caused by increased noise levels due to construction. Each exceedance was found to be affected by increased noise levels due to periods of weather, traffic, residential noise or bird noise. Audio demonstrates that the increased levels were caused by waves and birds at Butlaw Fisheries, birds and resident activity at Inchgarvie and birds at Tigh-na-Grian. With regard to the averages reported for evening and night-time periods, it should be noted that these averages are based only on the highest L_{Aeq} levels for 1 hour periods which can affect the averages.
- 3.6** During this month, some exceedances of the maximum noise thresholds occurred. Each exceedance of the threshold was investigated using triggered audio recordings, records of construction works (i.e. site programmes and diaries and daily marine reports) and analysis of weather station data, where required for these investigations. A Noise and Vibration Investigative Report (NVIR) spread sheet has been produced detailing the results of the investigation for each construction exceedance. There were some exceedances this month that were due to construction work (See 3.7).

- 3.7** During the month of October it was noted that there was construction related noise at Linn Mill. The exceedance at Linn Mill on the 2nd at night was due to a vehicle accessing the site before working hours. The environmental team made the site agent aware of this. The exceedances on the 5th, 6th and 29th October during the day seemed to be coming from the Scaffold/Timber storage area which is near the noise monitor. The Environmental team have contacted the relevant site agent and asked that staff be reminded to keep noise to a minimum, the environmental team will continue to monitor the situation closely. There were three exceedances at Dundas that occurred during the day time period, on the 23rd 26th and 27th October. This was caused by piling activity. There were two construction related exceedances at Tigh-Na-Grain. An exceedance occurred during the night of the 5th, apparently caused by somebody using either a loud hailer or perhaps a car stereo. This may or may not have been from vessels. A brief was given to site staff about keeping quiet at night. The exceedance on the 8th occurred at night and was due to hammering noises. The environmental team contacted site teams to remind them about hammering at night.
- 3.8** The majority of exceedances at all locations were caused by various noise sources, such as traffic, residential noise and birds. At some locations, notably Scotstoun and Echline, existing traffic noise had an effect on maximum noise levels during the period covered in this report. Butlaw Fisheries also records a high number of waves against the shore. Ongoing residential building works at Inchgarvie Lodge accounts for the majority of the exceedances at this location.
- 3.9** A summary of the findings for exceedances occurring at each of the locations can be found in Table 2.

Table 2: Summary of Exceedances at Monitoring Locations

Monitoring Location	Summary of Exceedance Details
Butlaw Fisheries	During October the maximum noise threshold was exceeded on 40 occasions (9 day time, 4 evening and 27 night time). Exceedances were attributed to non-construction factors notably birds, traffic, waves and residents.
Clufflat Brae	During October the maximum noise threshold was exceeded on 20 occasions (12 daytime, 3 evening and 5 night time). No exceedances were found to be due to construction works. Exceedances were found to be due to birds, residential activity, planes and high winds.
Inchgarvie Lodge	During October the maximum noise threshold was exceeded on 44 occasions (20 day time, 9 evening and 15 night time). No exceedances were attributed to construction works. Investigations found residential building works and vehicle movements the main contributing factors to the exceedances in this location. Other factors included birds and high winds.
Linn Mill	During October the maximum noise threshold was exceeded on 26 occasions (14 daytime, 4 evening and 8 night time). The majority of exceedances at this location were due to birds and residents. There were 4 instances of construction noise exceeding the threshold (see 3.7)
Tigh-Na-Grian	During October the maximum noise threshold was exceeded on 42 occasions (19 daytime, 0 evening and 23 night time). Exceedances were mainly due to birds.
Dundas Home Farm	During October the maximum noise threshold was exceeded on 16 occasions. There were 3 instances of construction noise exceeding the threshold (see 3.7). The other exceedances were due to residents and birds.
Echline	During October the maximum noise threshold was exceeded on 31 occasions. No exceedances at this location were due to construction activities. Most exceedances were attributed to vehicles passing by on the adjacent roads. Another exceedance was attributed to a chainsaw however this was not FCBC construction related
Springfield	During October the maximum noise threshold was exceeded on 17 occasions. These exceedances were due to local residents, their pet dog, as well as birds. The monitor is situated within a garden with a dog next door.
Scotstoun	During October the maximum noise threshold was exceeded on 31 occasions. The majority of exceedances were attributed to vehicles passing (including Sundays) on the adjacent road. There was 8 construction related exceedance (see 3.4)
Whinny Hill	During October the maximum noise threshold was exceeded on 10 occasions. Exceedances were not due to construction activities. Mostly, exceedances were due to birds, planes, residents and vehicles.
North Leg	No data is reported in this report is due to the monitor being calibrated. Recordings taken for data record purposes
Port Edgar	No data is reported before 8 th October due to an error with the monitor. Recordings taken for data record purposes
Newton	Recordings taken for data record purposes




Forth Crossing Bridge Constructors

HOCHTIEF Solutions
American Bridge International
DRAGADOS
Morrison Construction

APPENDIX A


Measured Daytime Noise Levels at Butlaw Fisheries

Measurement period: October 2015

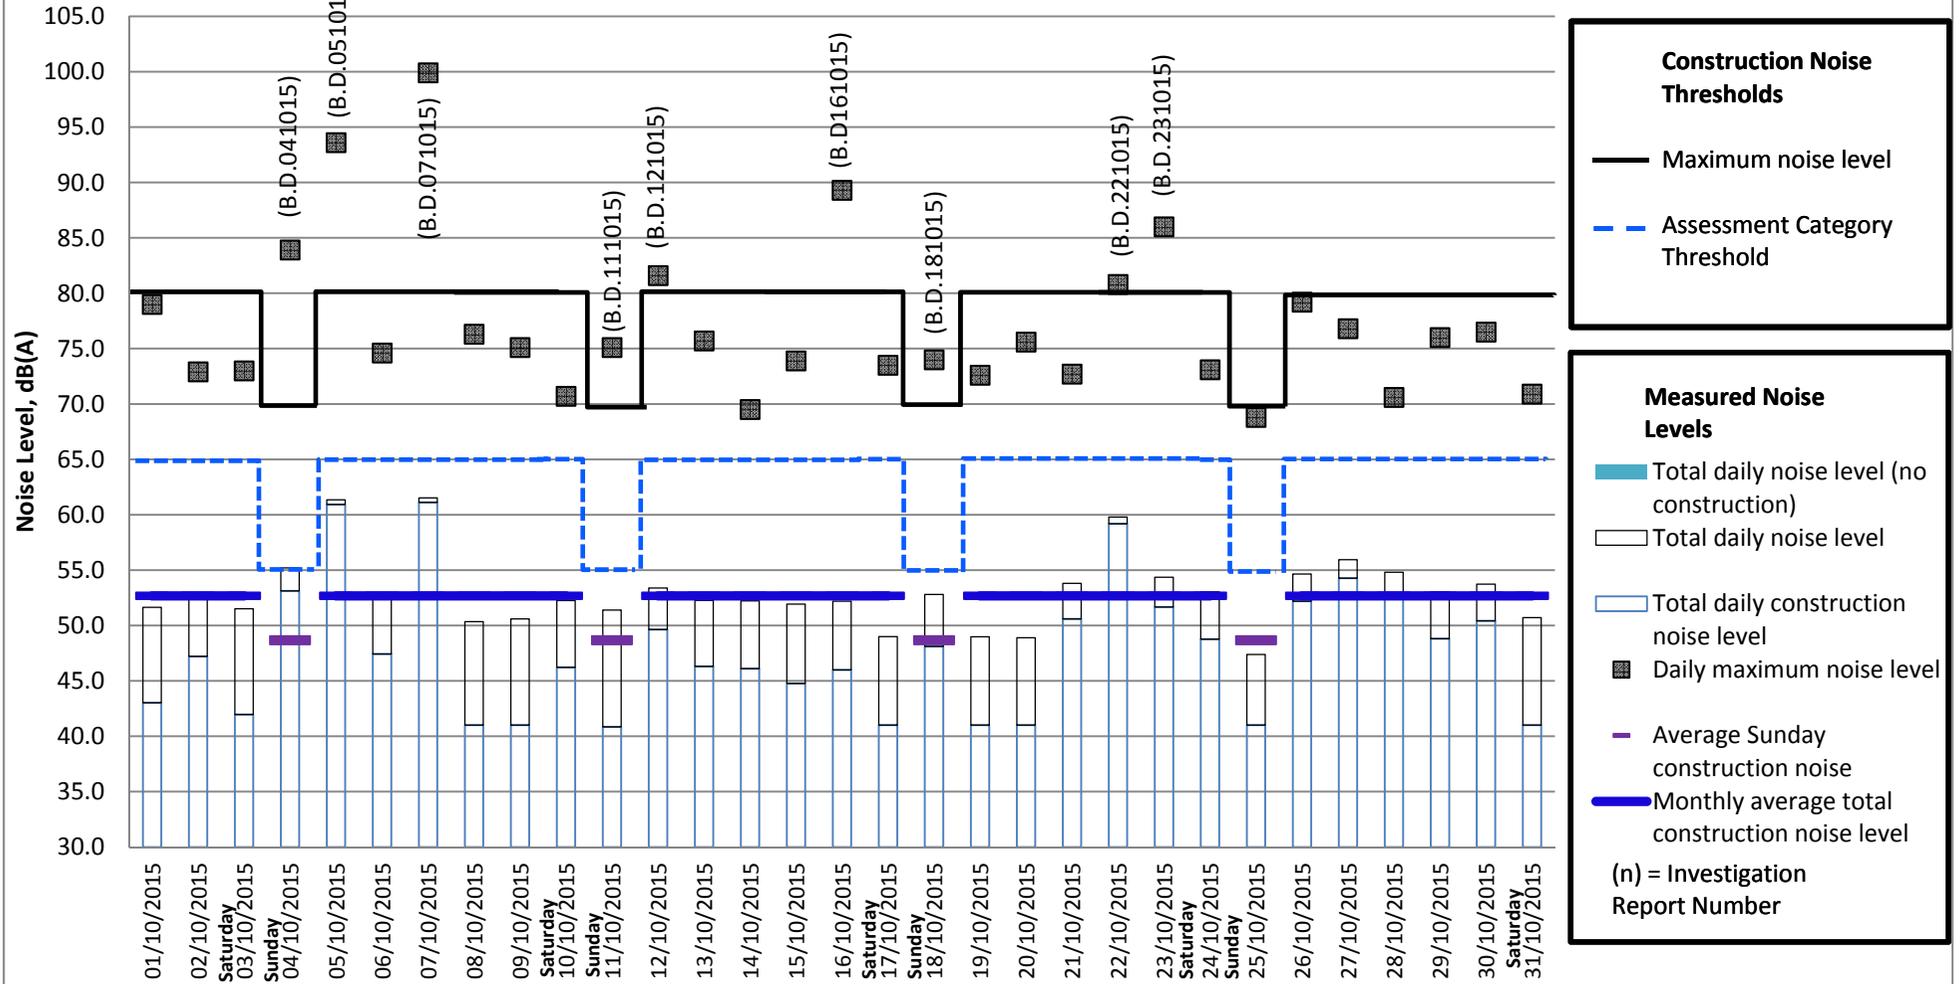


Measured Evening Noise Levels at Butlaw Fisheries

Measurement period: October 2015

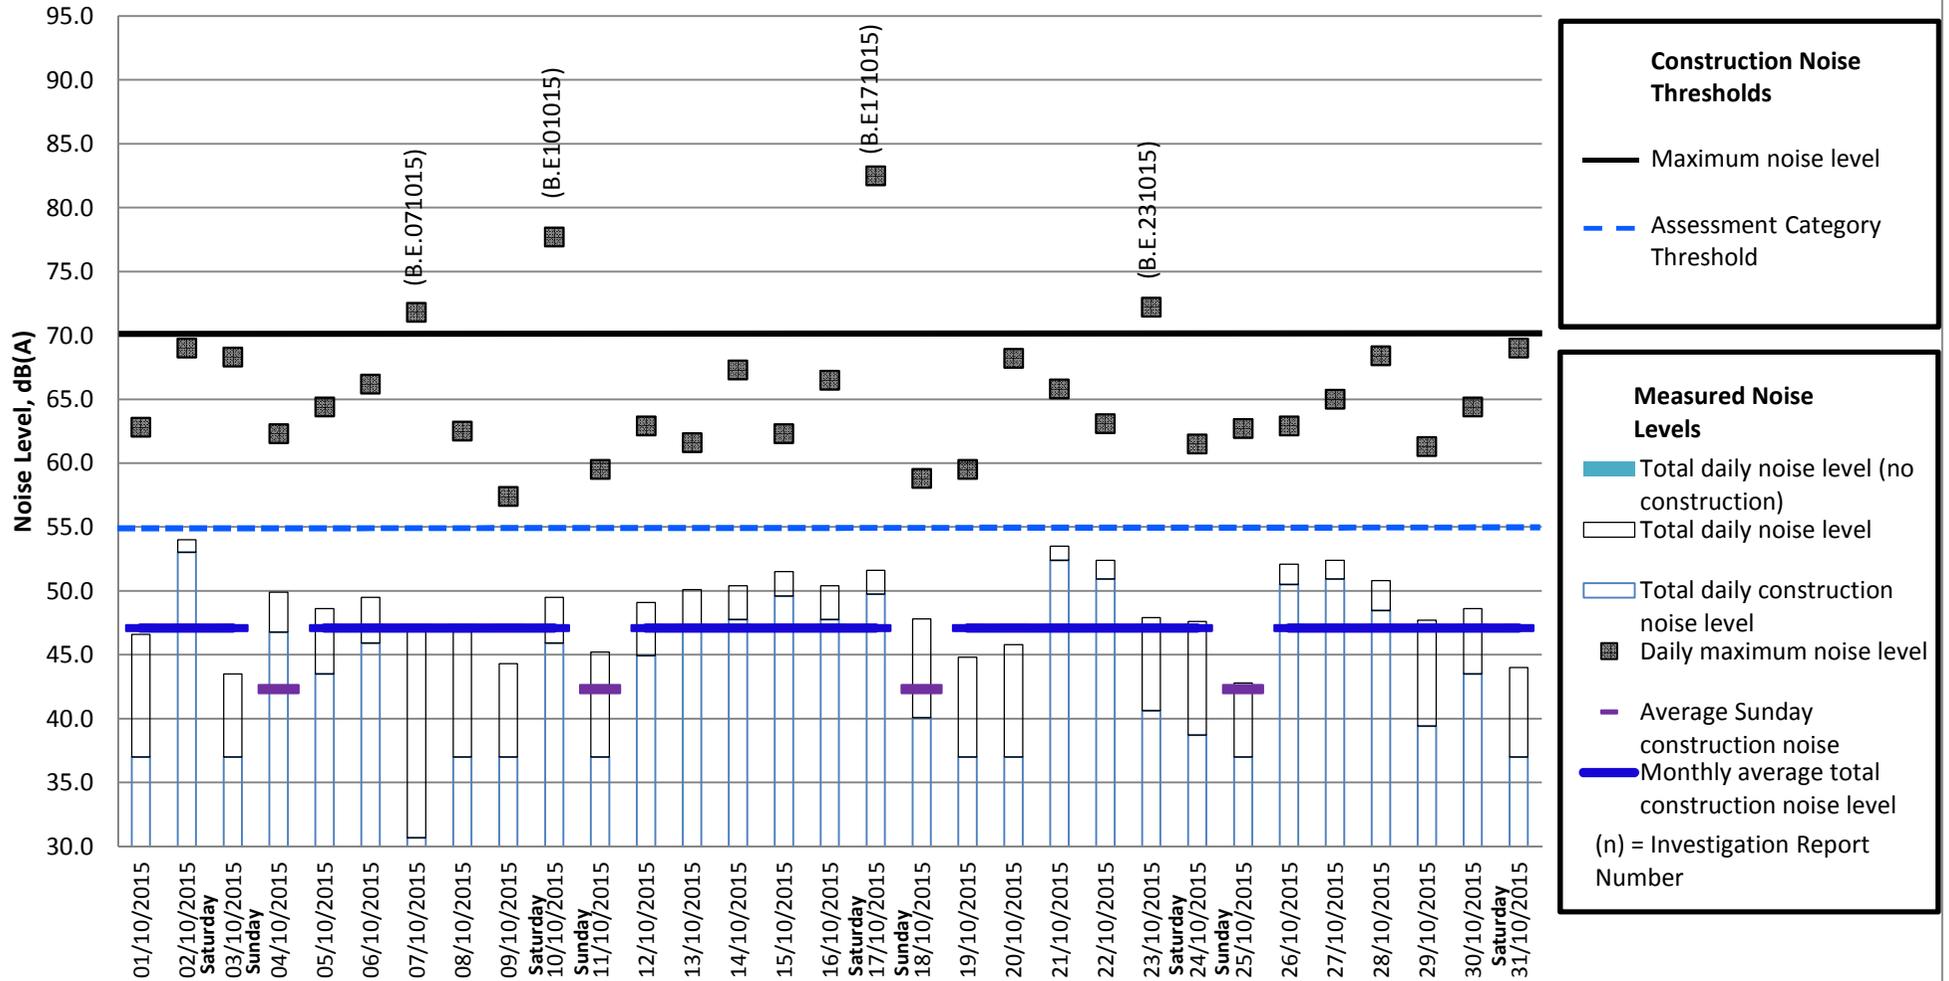


Measured Night time Noise Levels at Butlaw Fisheries Measurement period: October 2015

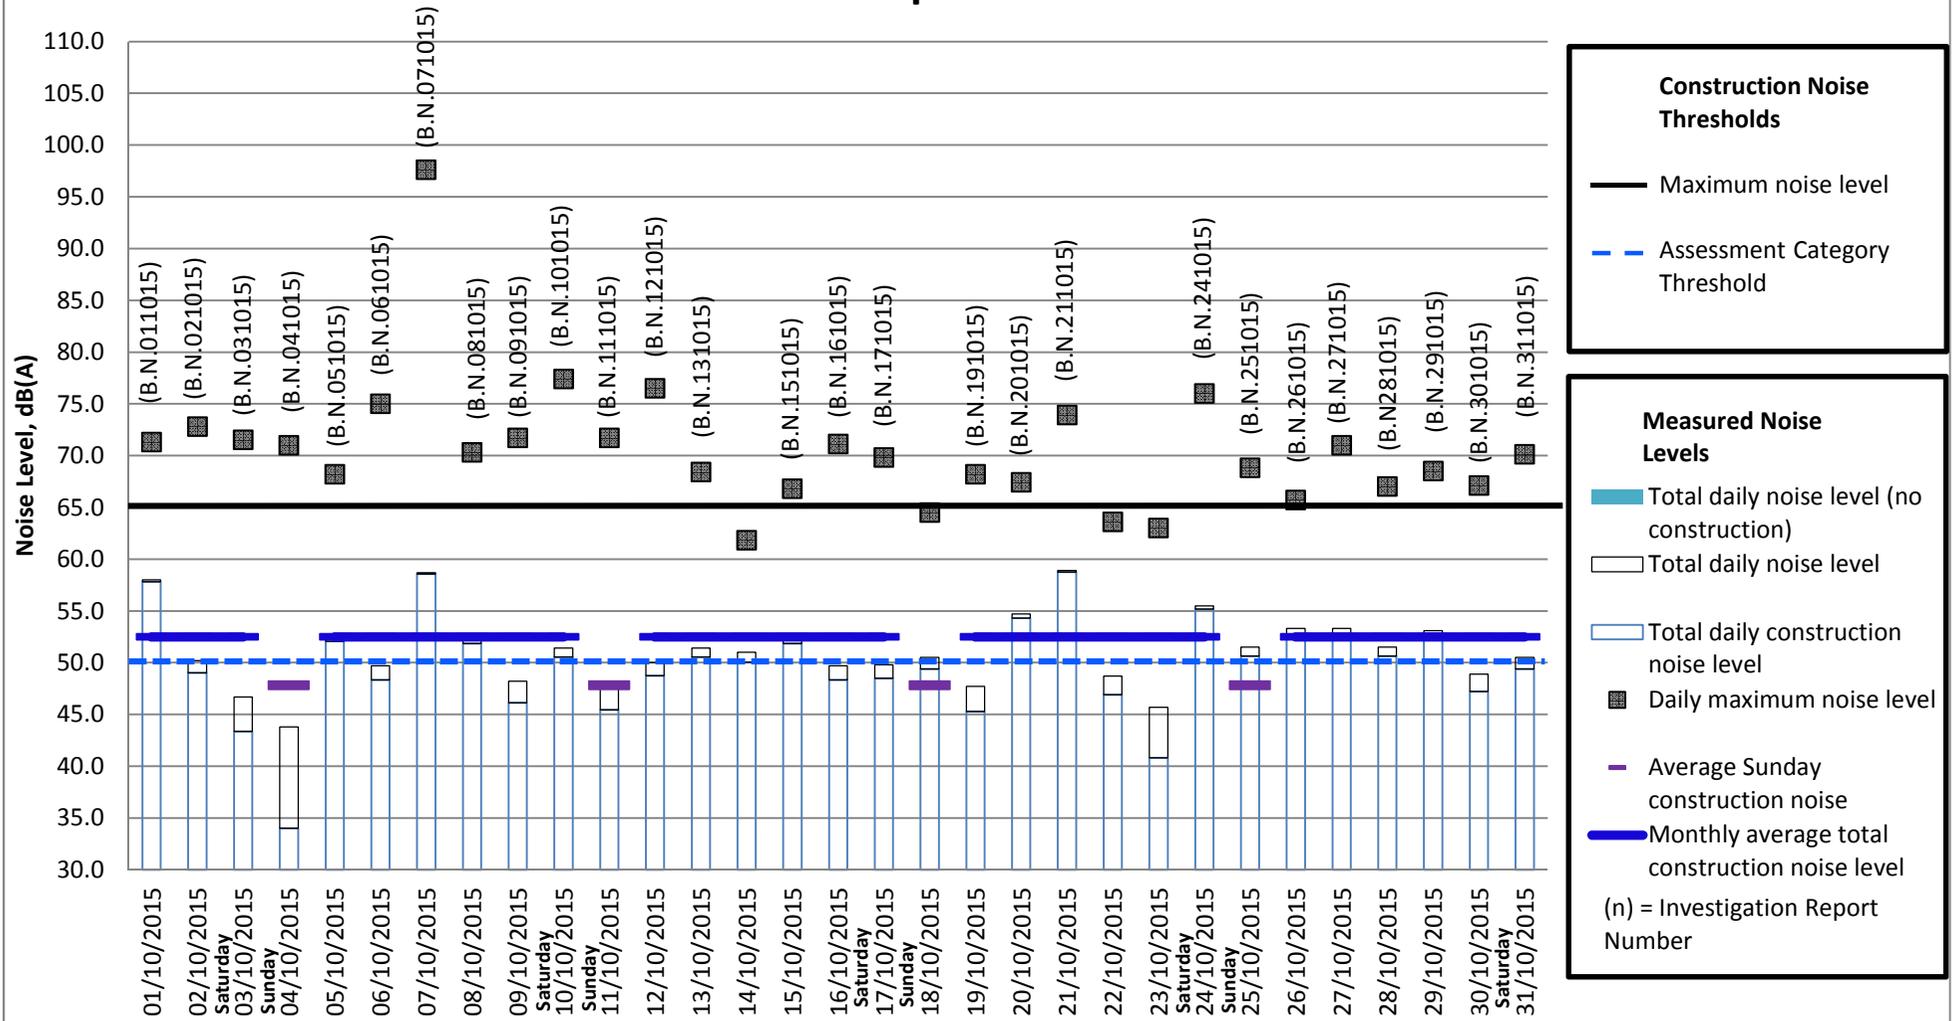

Note: After investigation, it was concluded that the exceedances of the LAeq 'Total Daily Construction' through the month were caused by birds and waves.


Measured Daytime Noise Levels at Clufflat

Measurement period: October 2015

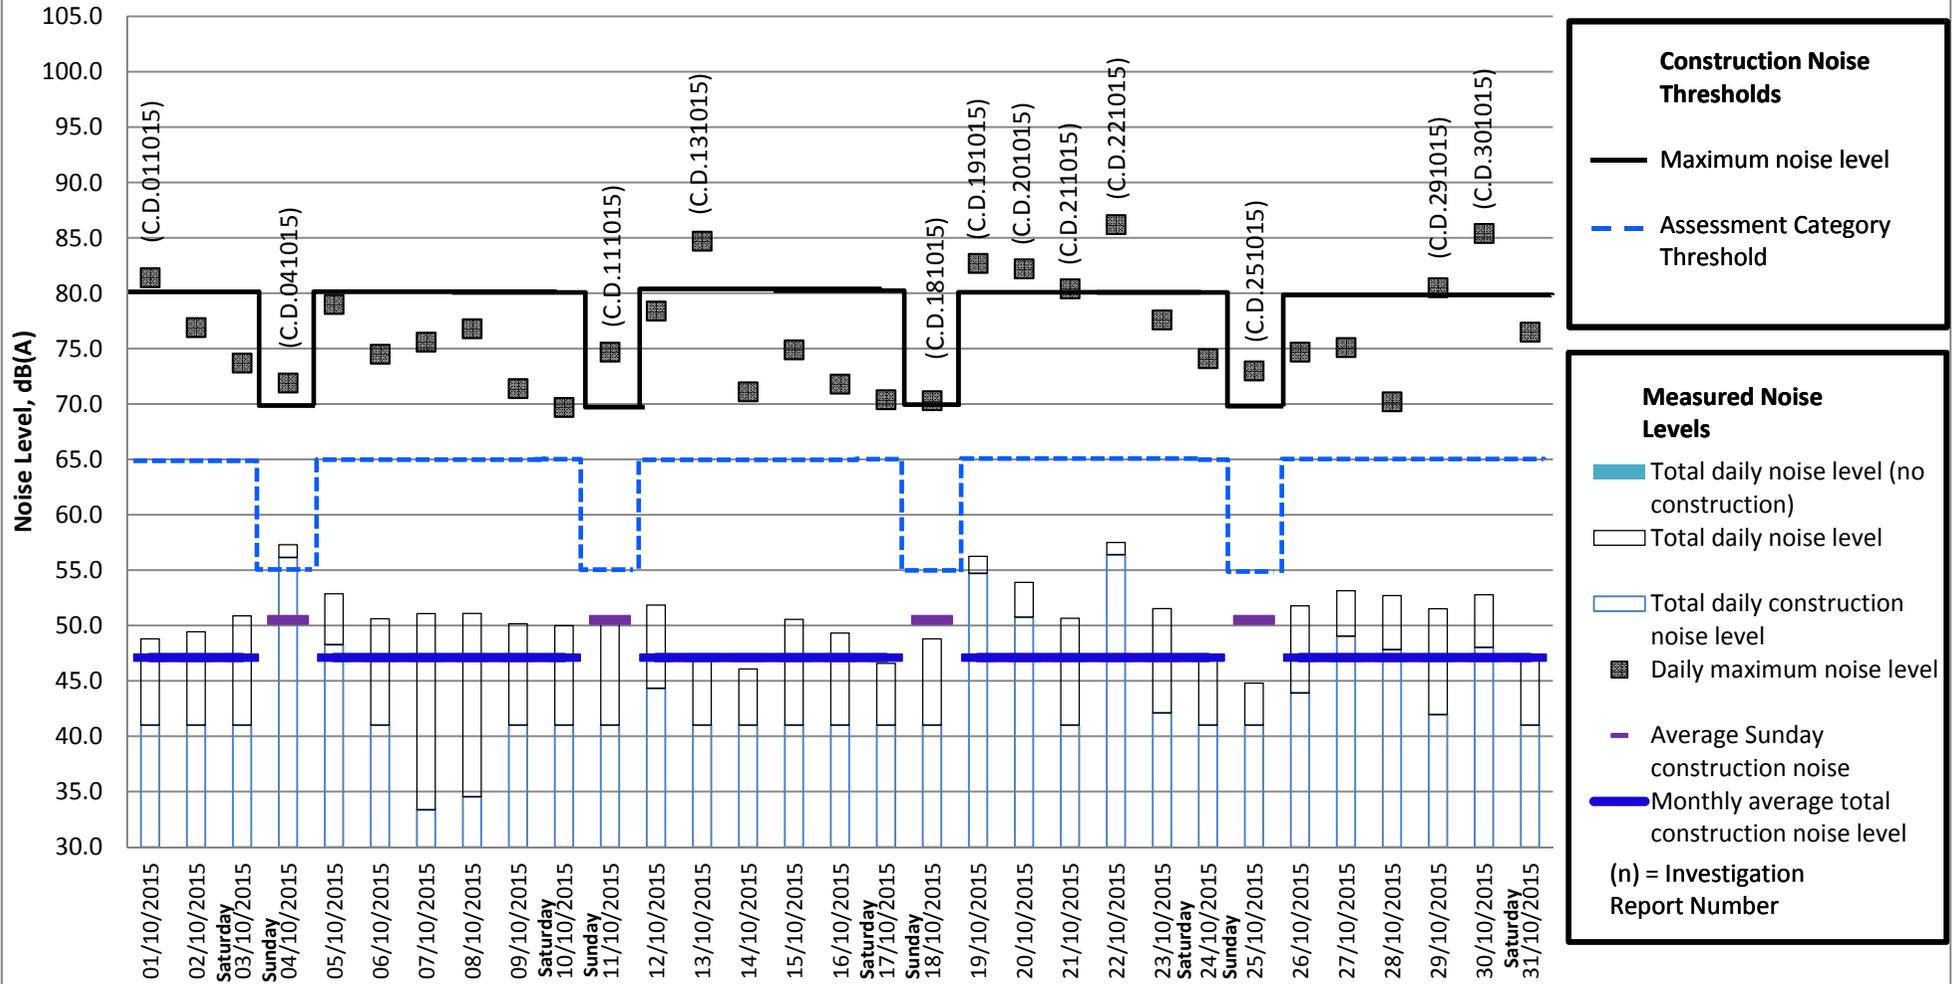


Measured Evening Noise Levels at Clufflat

Measurement period: October 2015

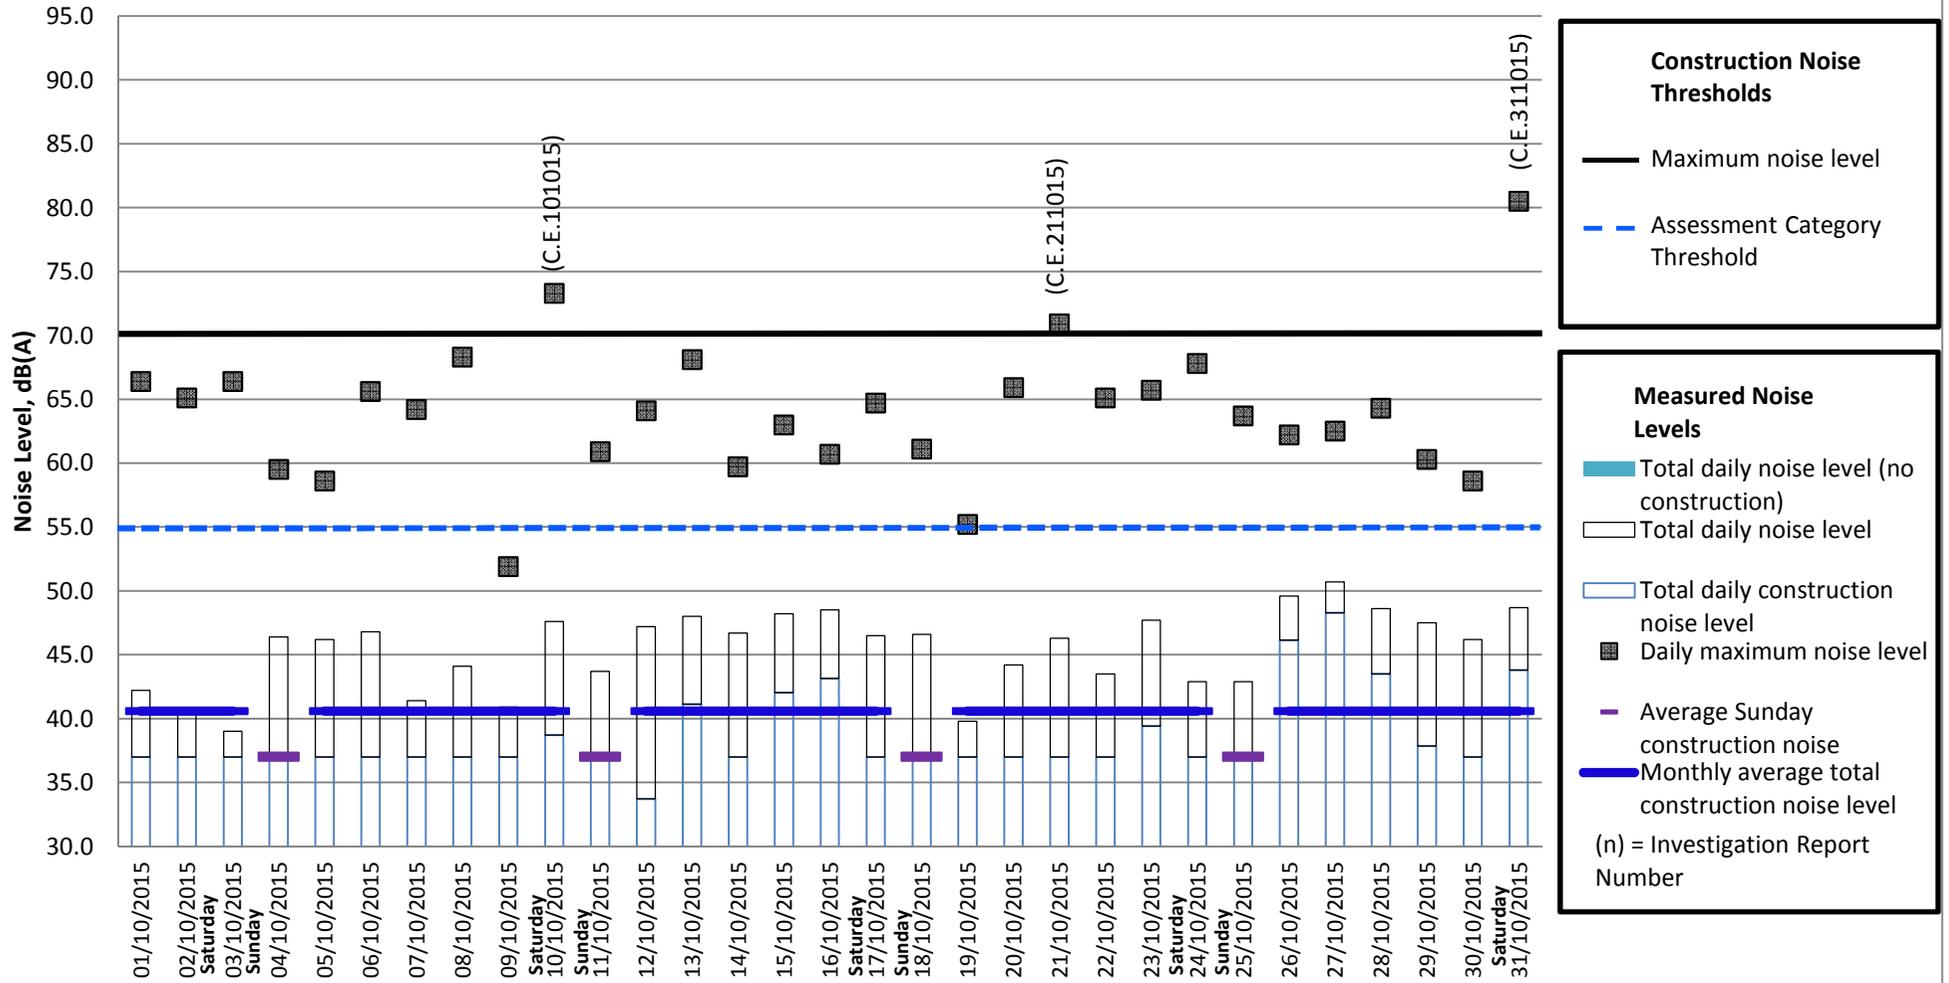


Measured Night time Noise Levels at Clufflat

Measurement period: October 2015

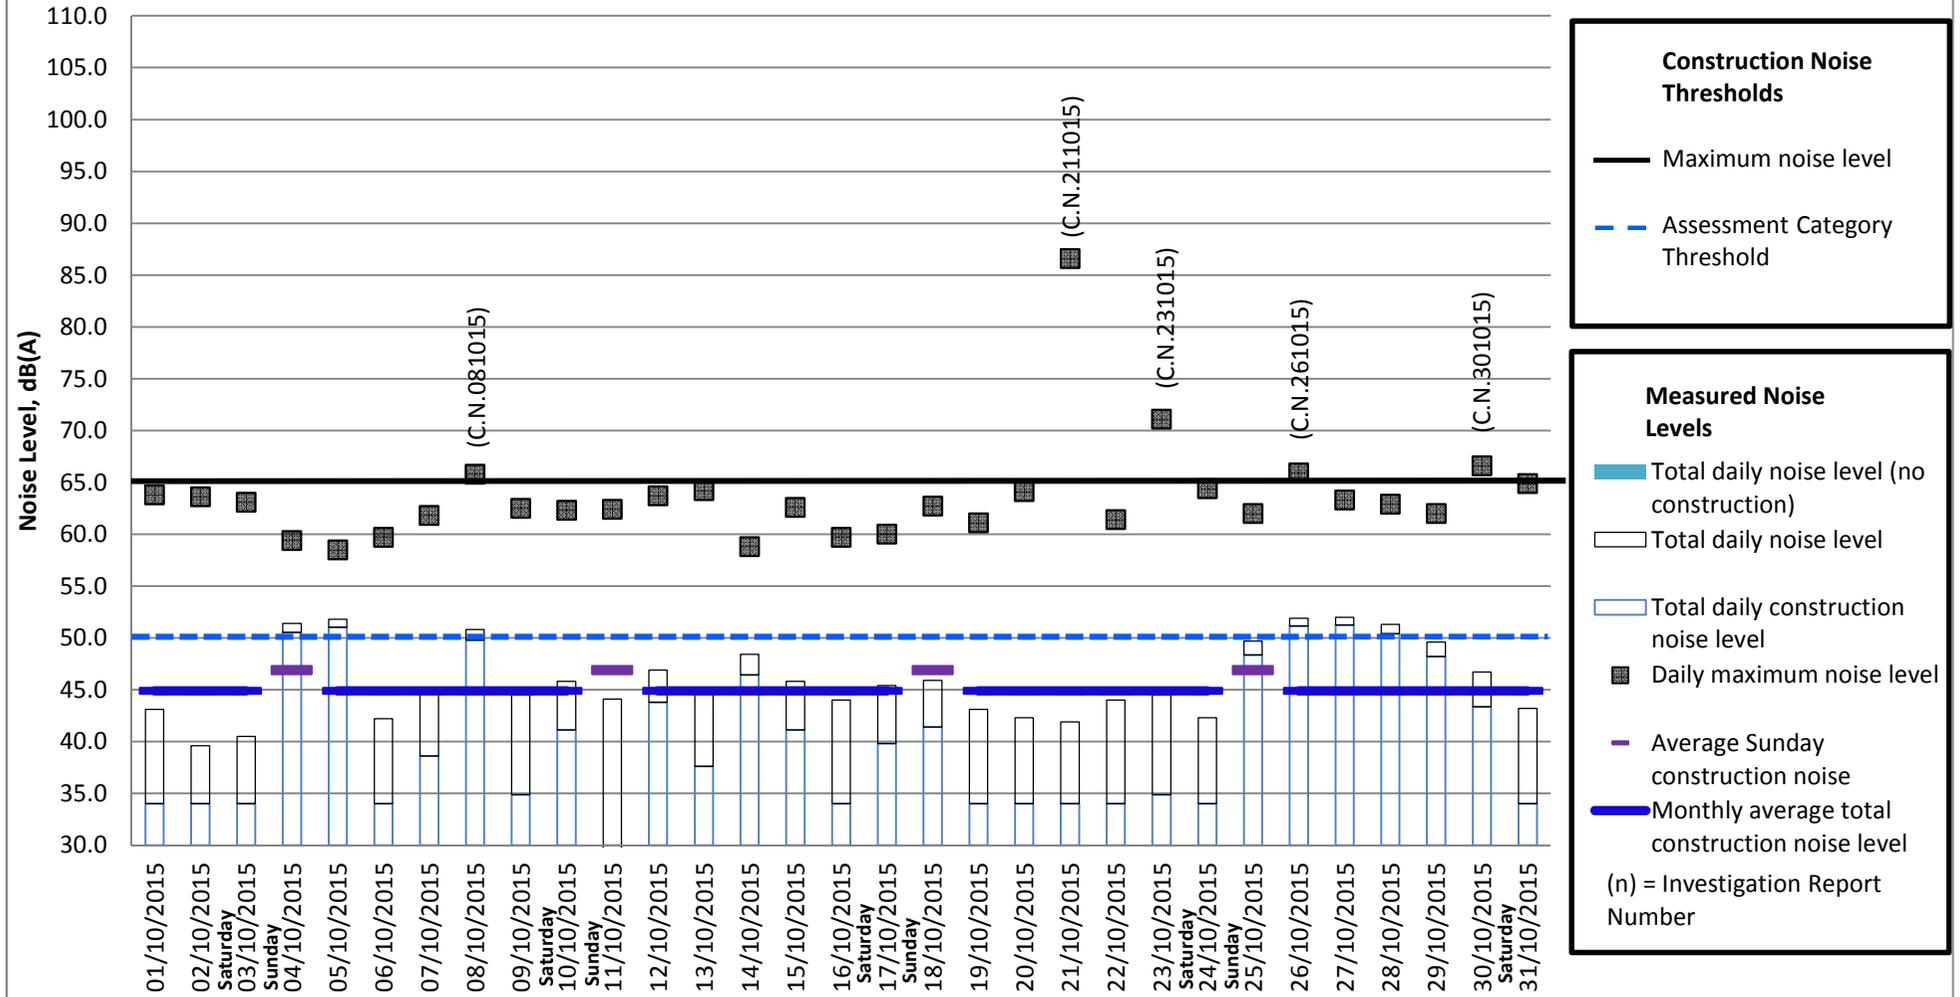


Measured Daytime Noise Levels at Inchgarvie Measurement period: October 2015

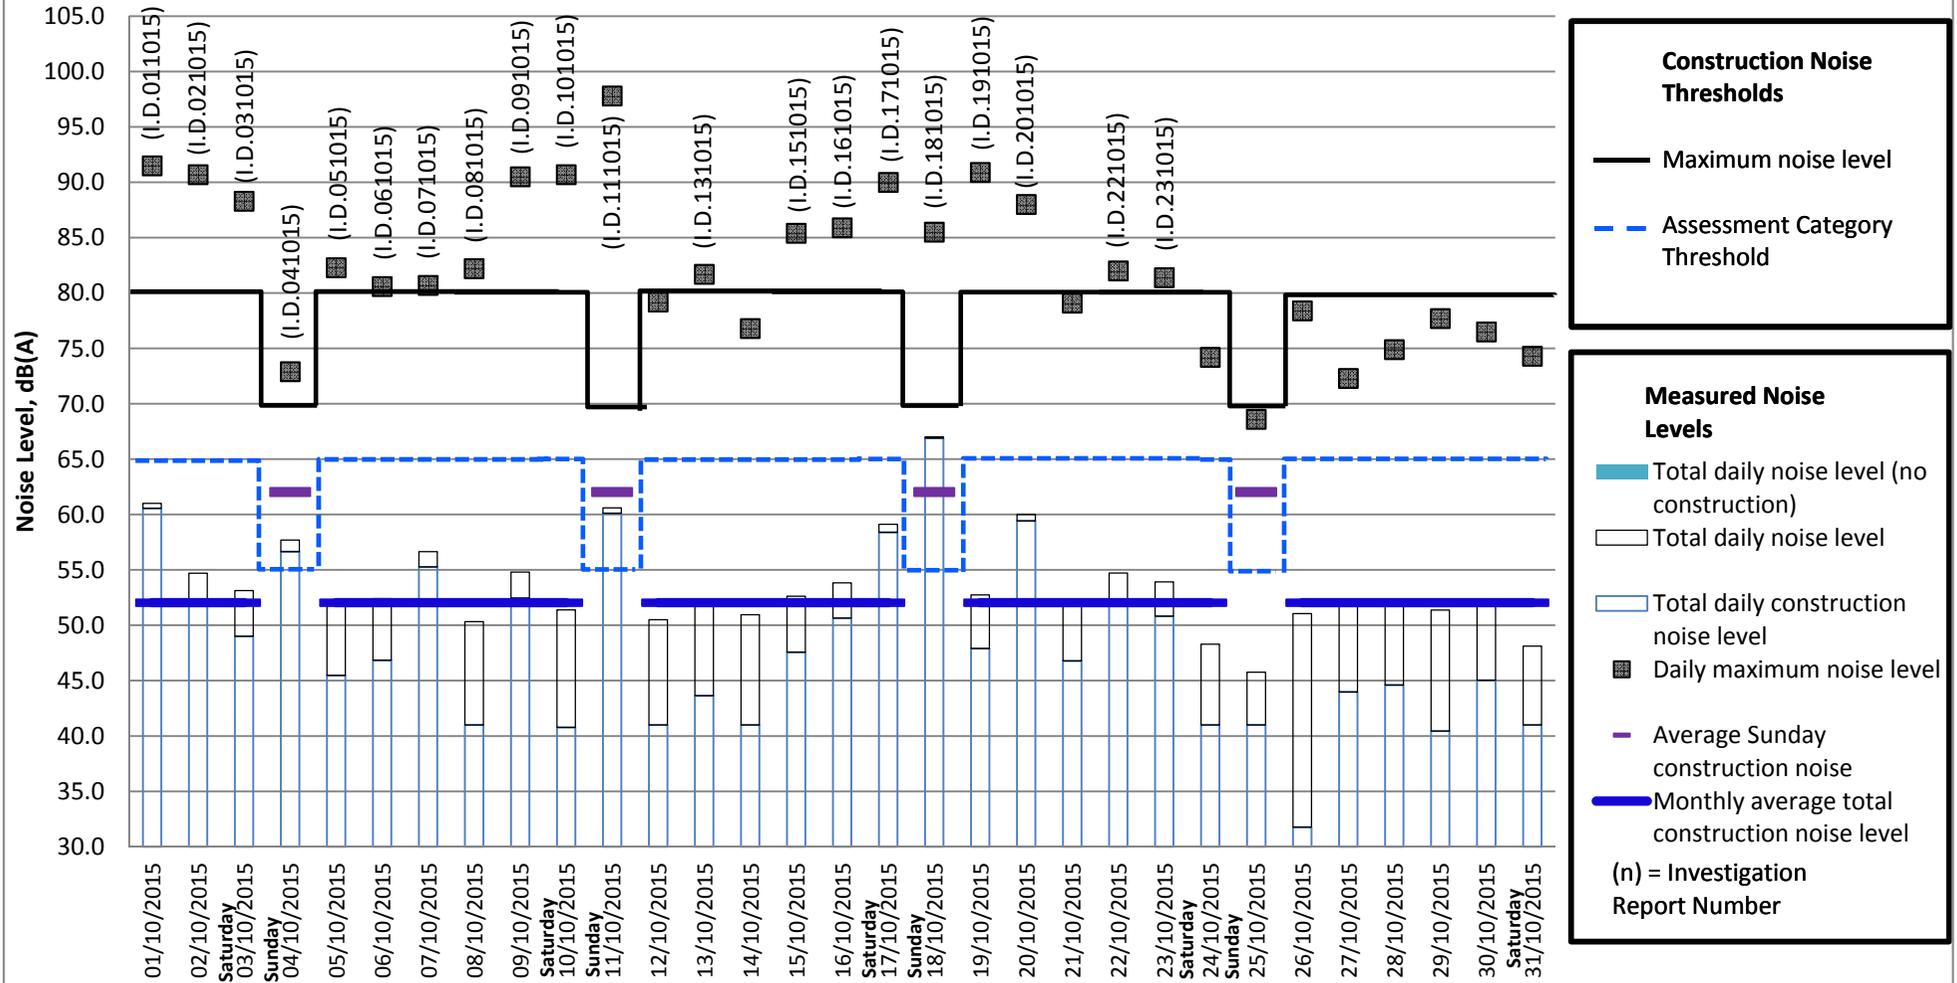

Note; After investigation it was concluded that the exceedances of the 'Average Sunday construction noise' through the month were caused by residential building works


Measured Evening Noise Levels at Inchgarvie

Measurement period: October 2015

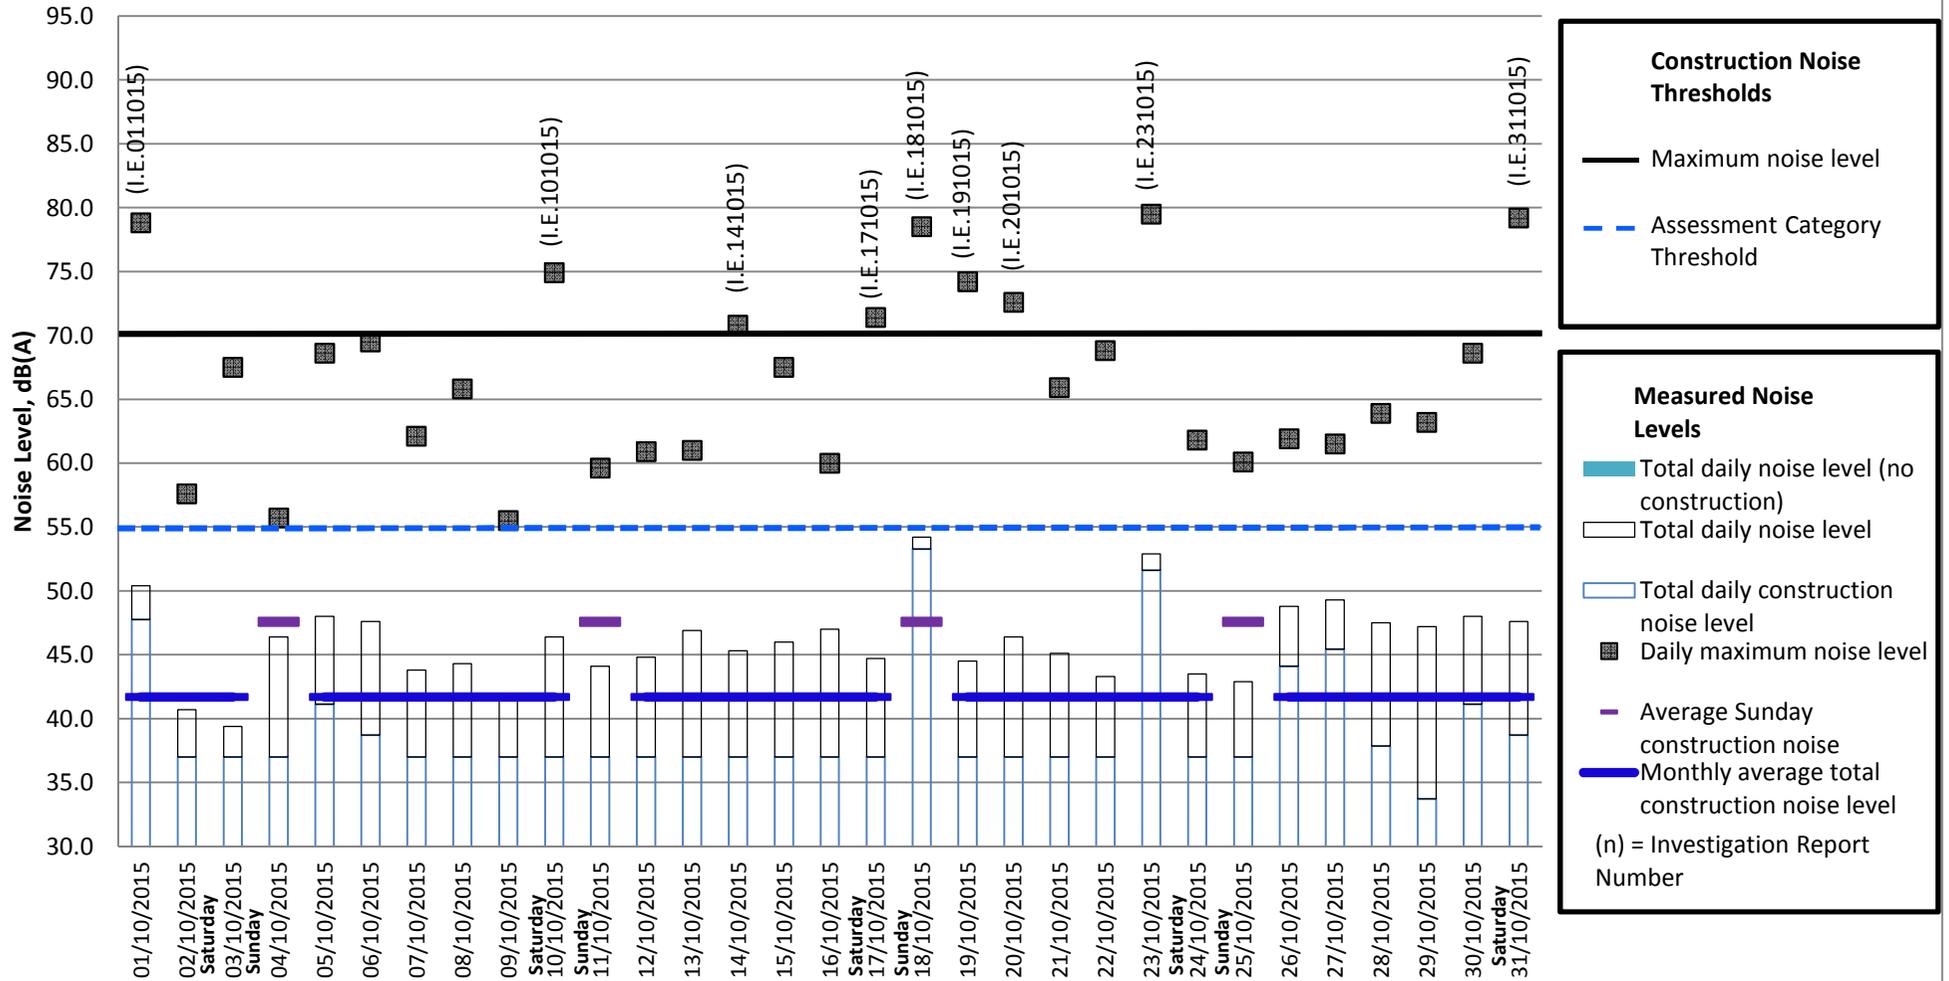


Measured Night time Noise Levels at Inchgarvie

Measurement period: October 2015

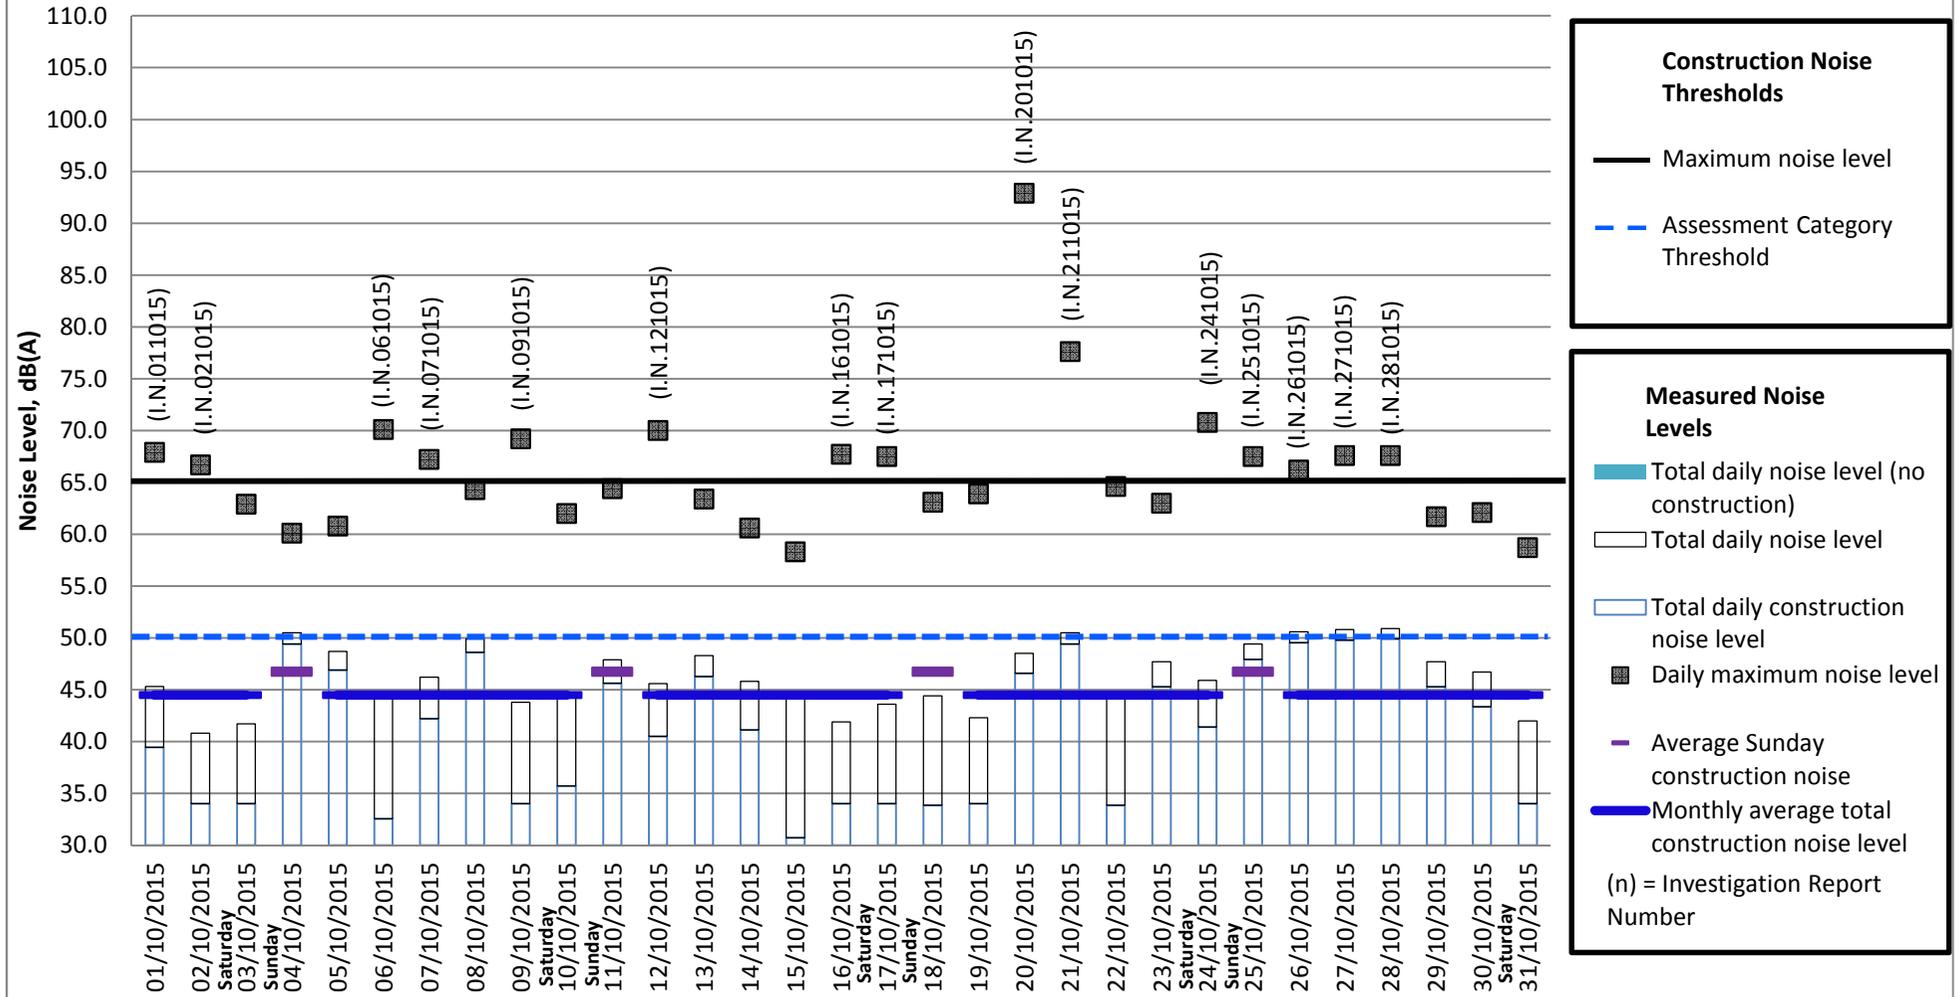


Measured Daytime Noise Levels at Linn Mill

Measurement period: October 2015

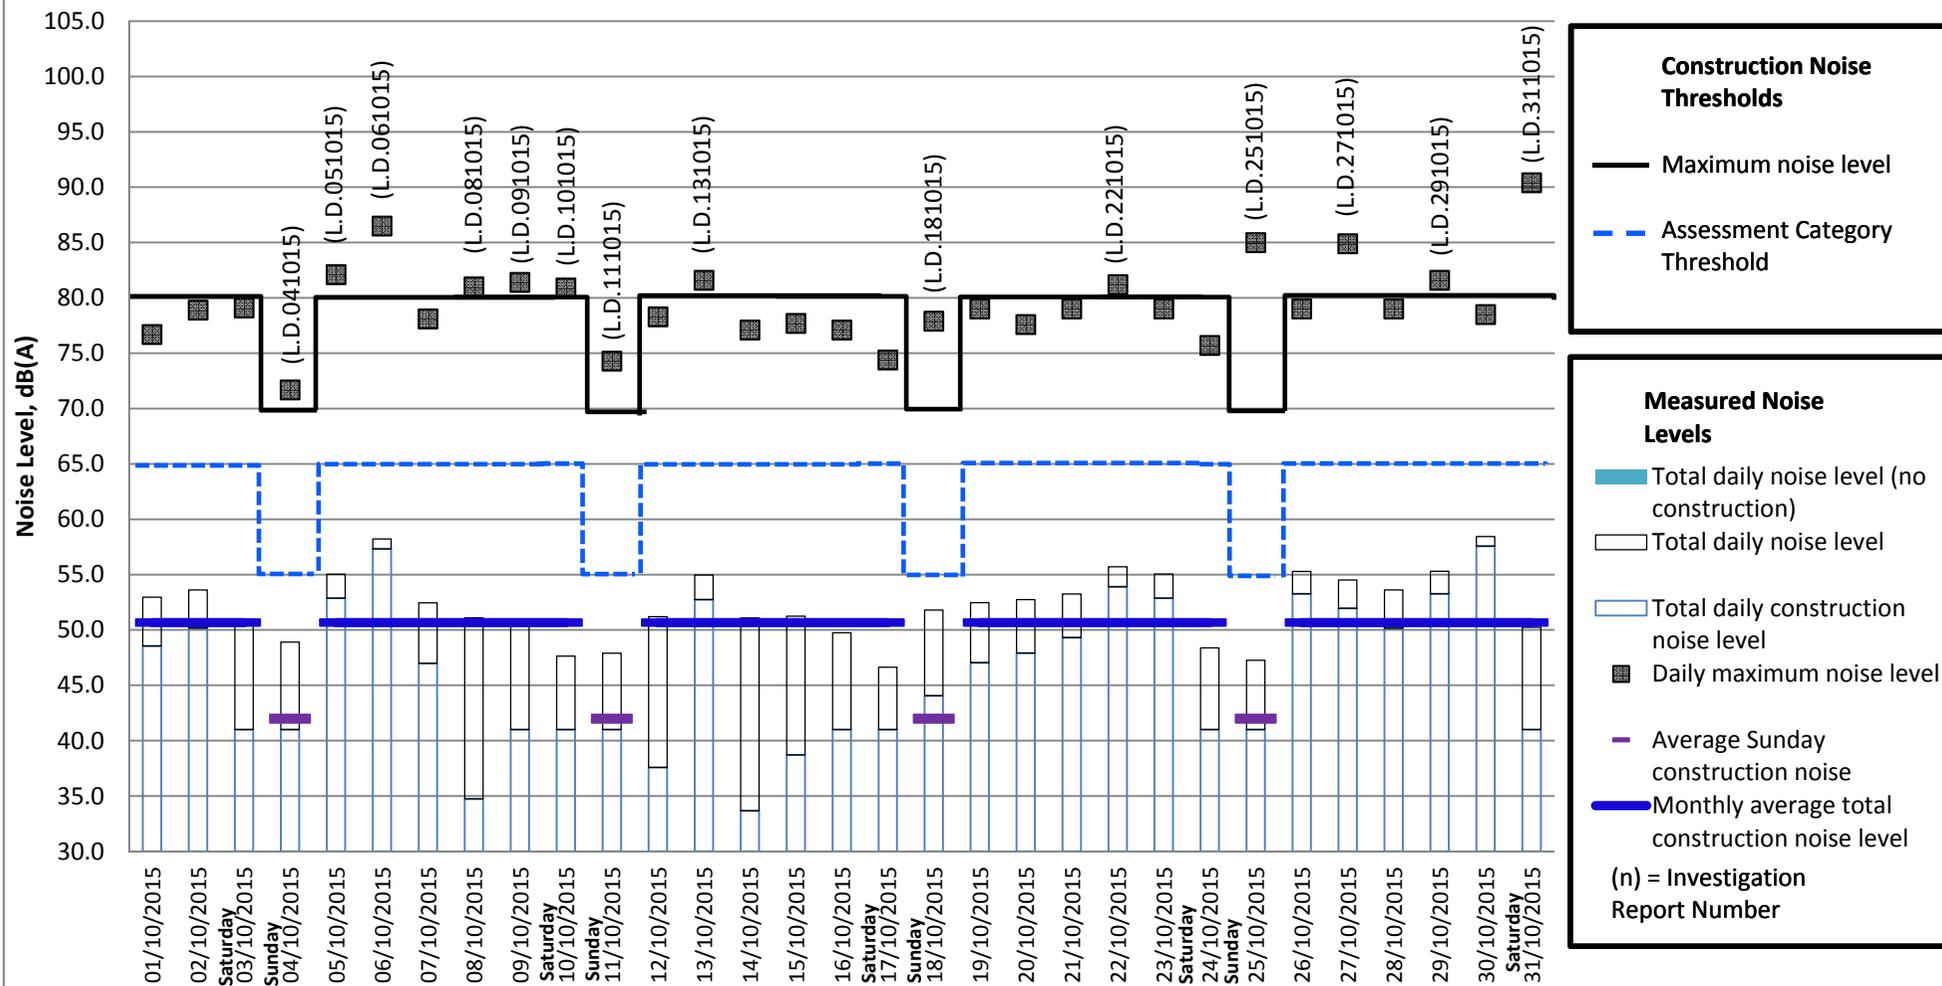


Measured Evening Noise Levels at Linn Mill

Measurement period: October 2015

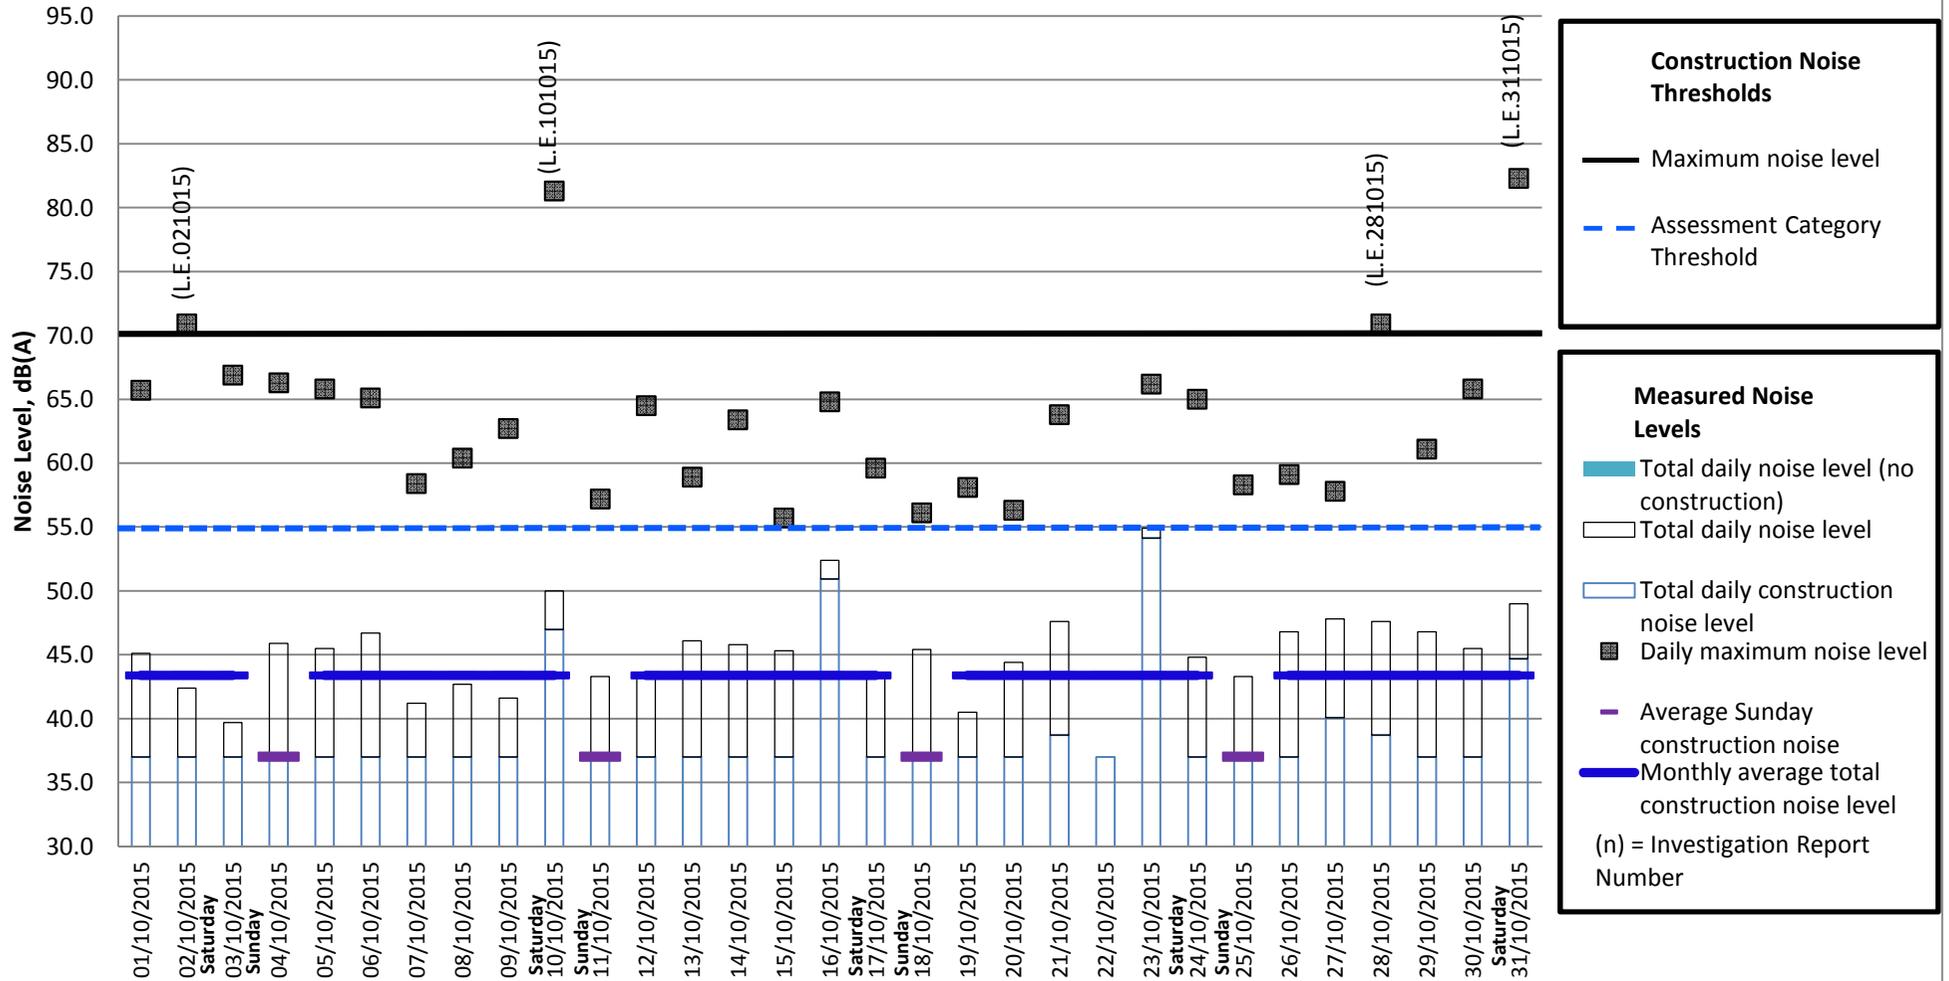


Measured Night time Noise Levels at Linn Mill

Measurement period: October 2015

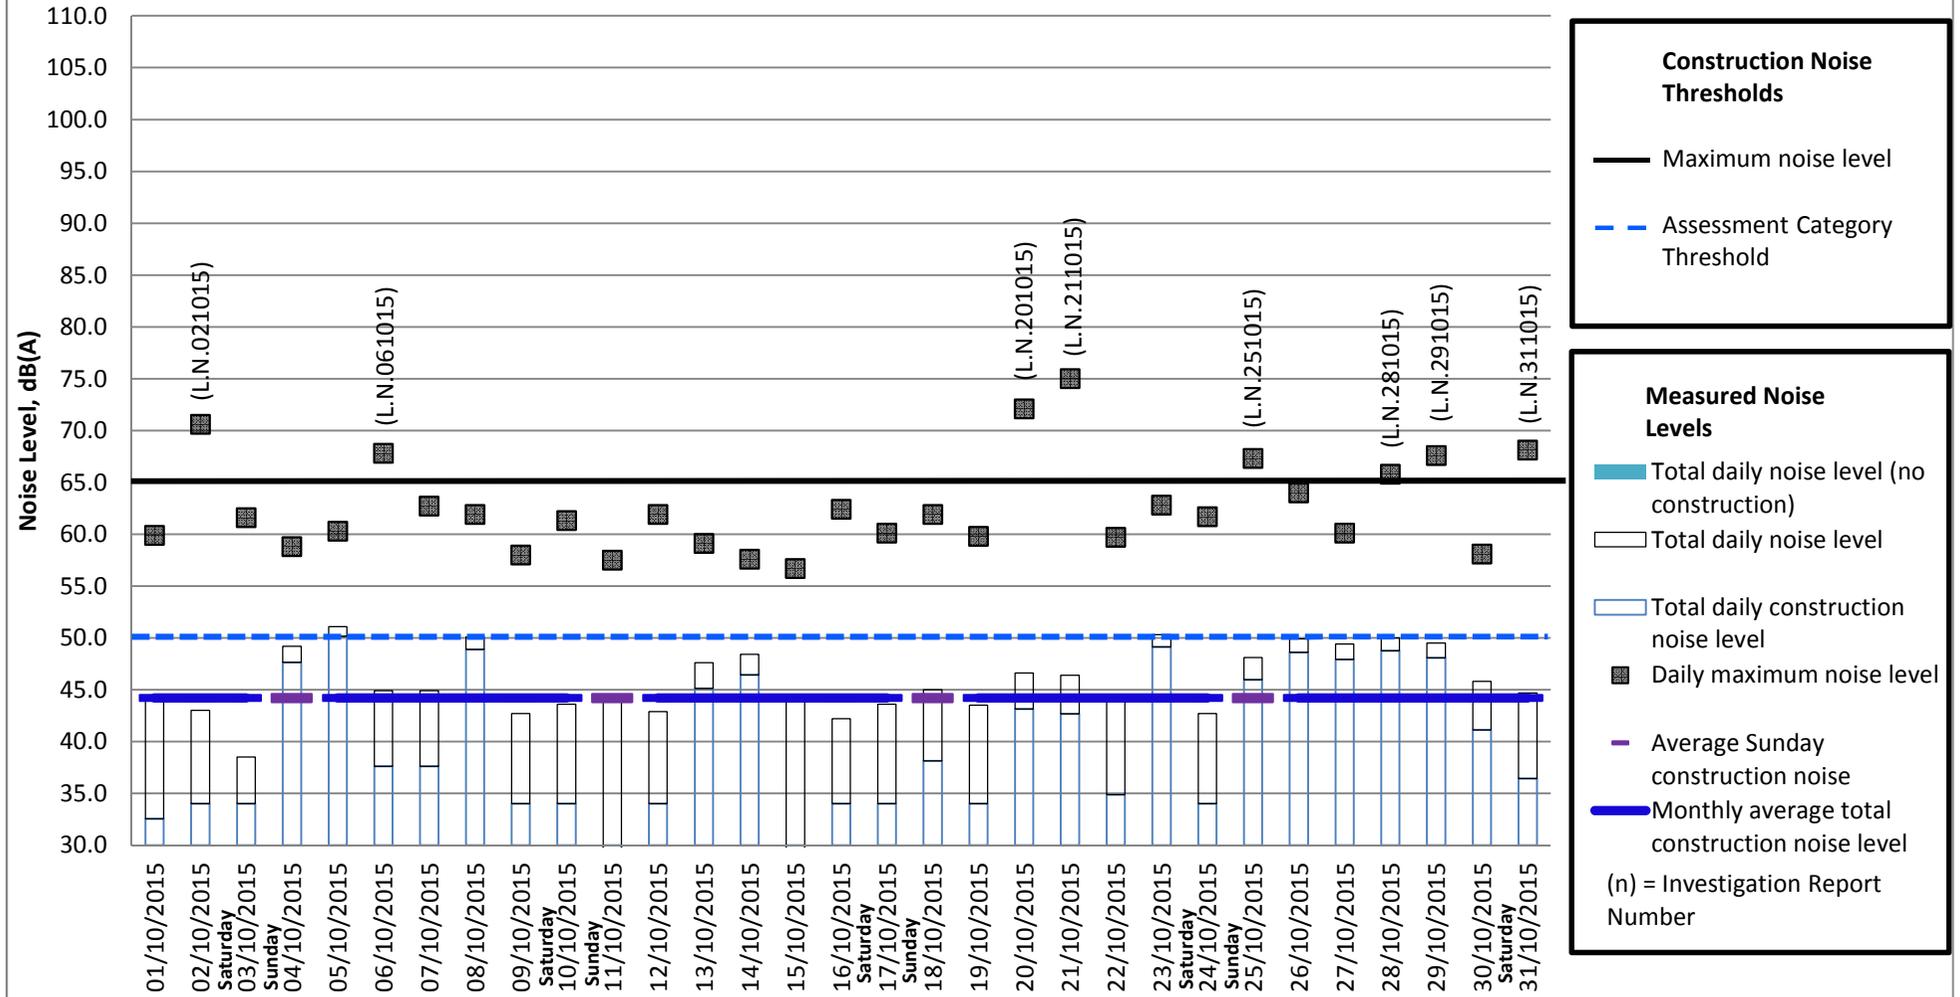


Measured Daytime Noise Levels at Tigh-Na-Grian

Measurement period: October 2015

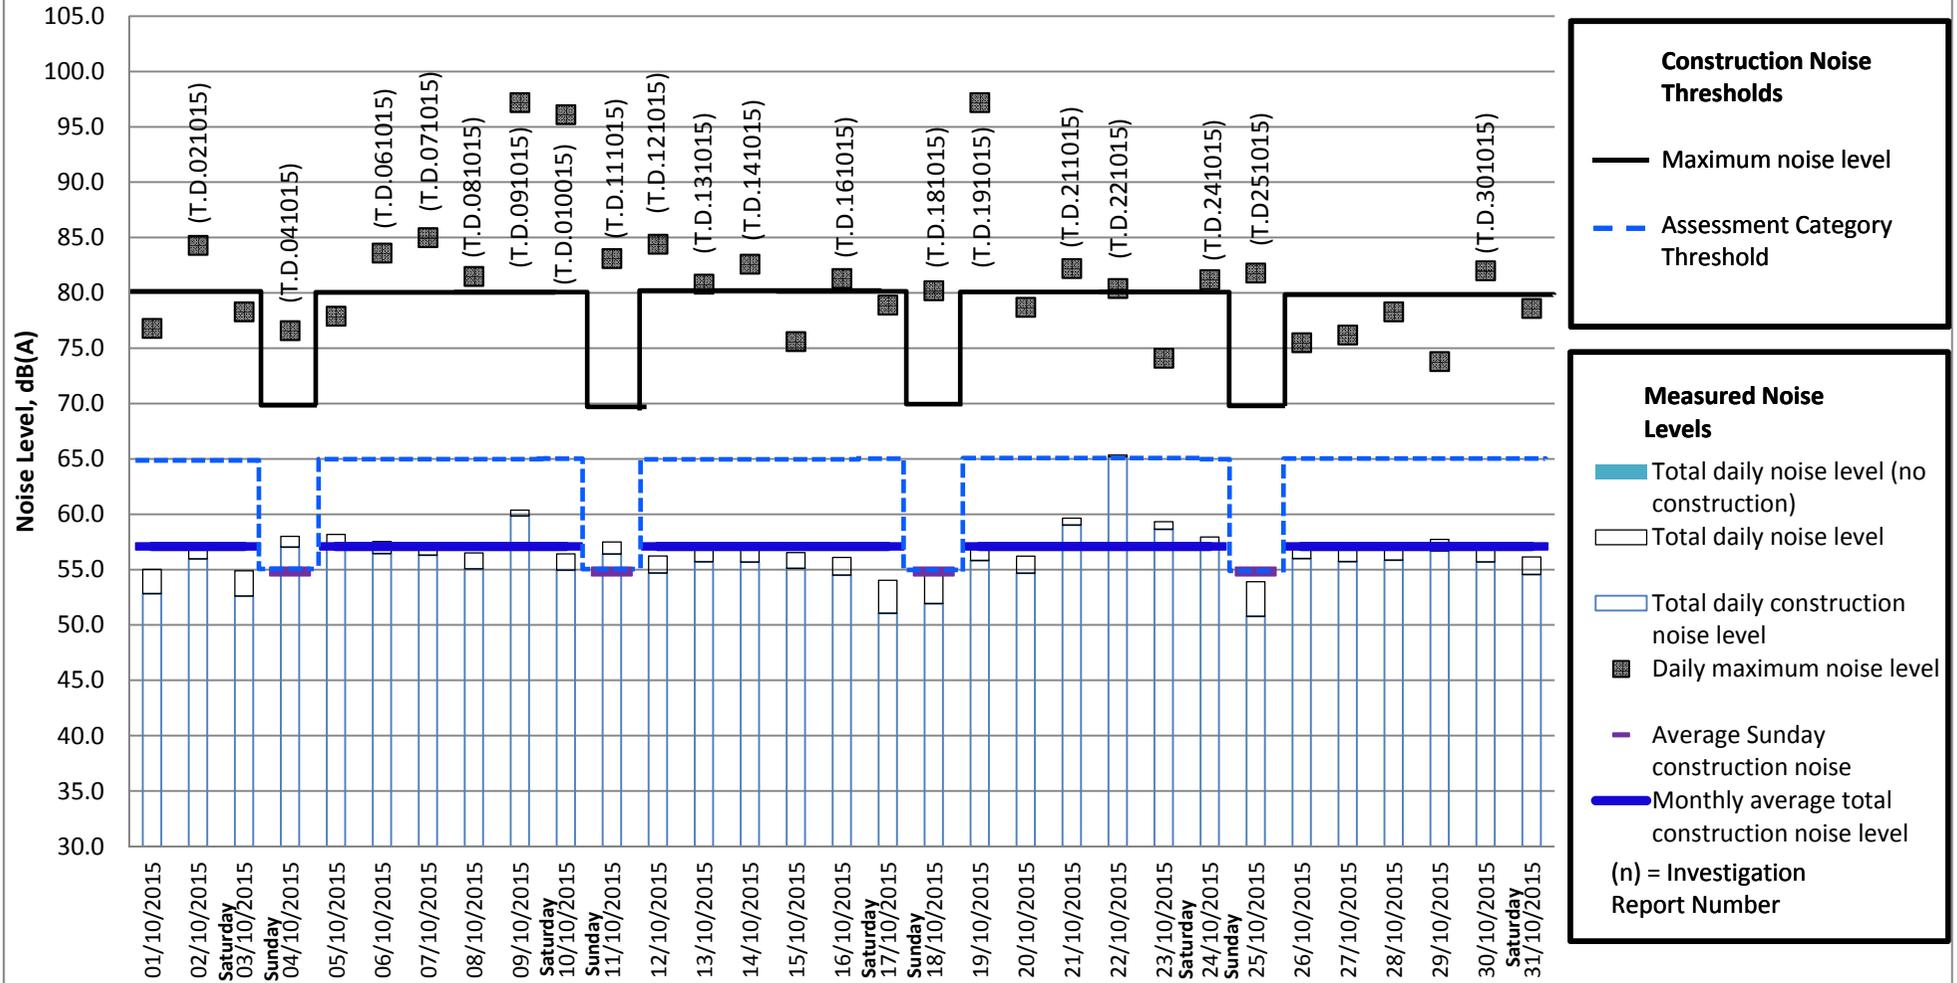


Measured Evening Noise Levels at Tigh-Na-Grian

Measurement period: October 2015

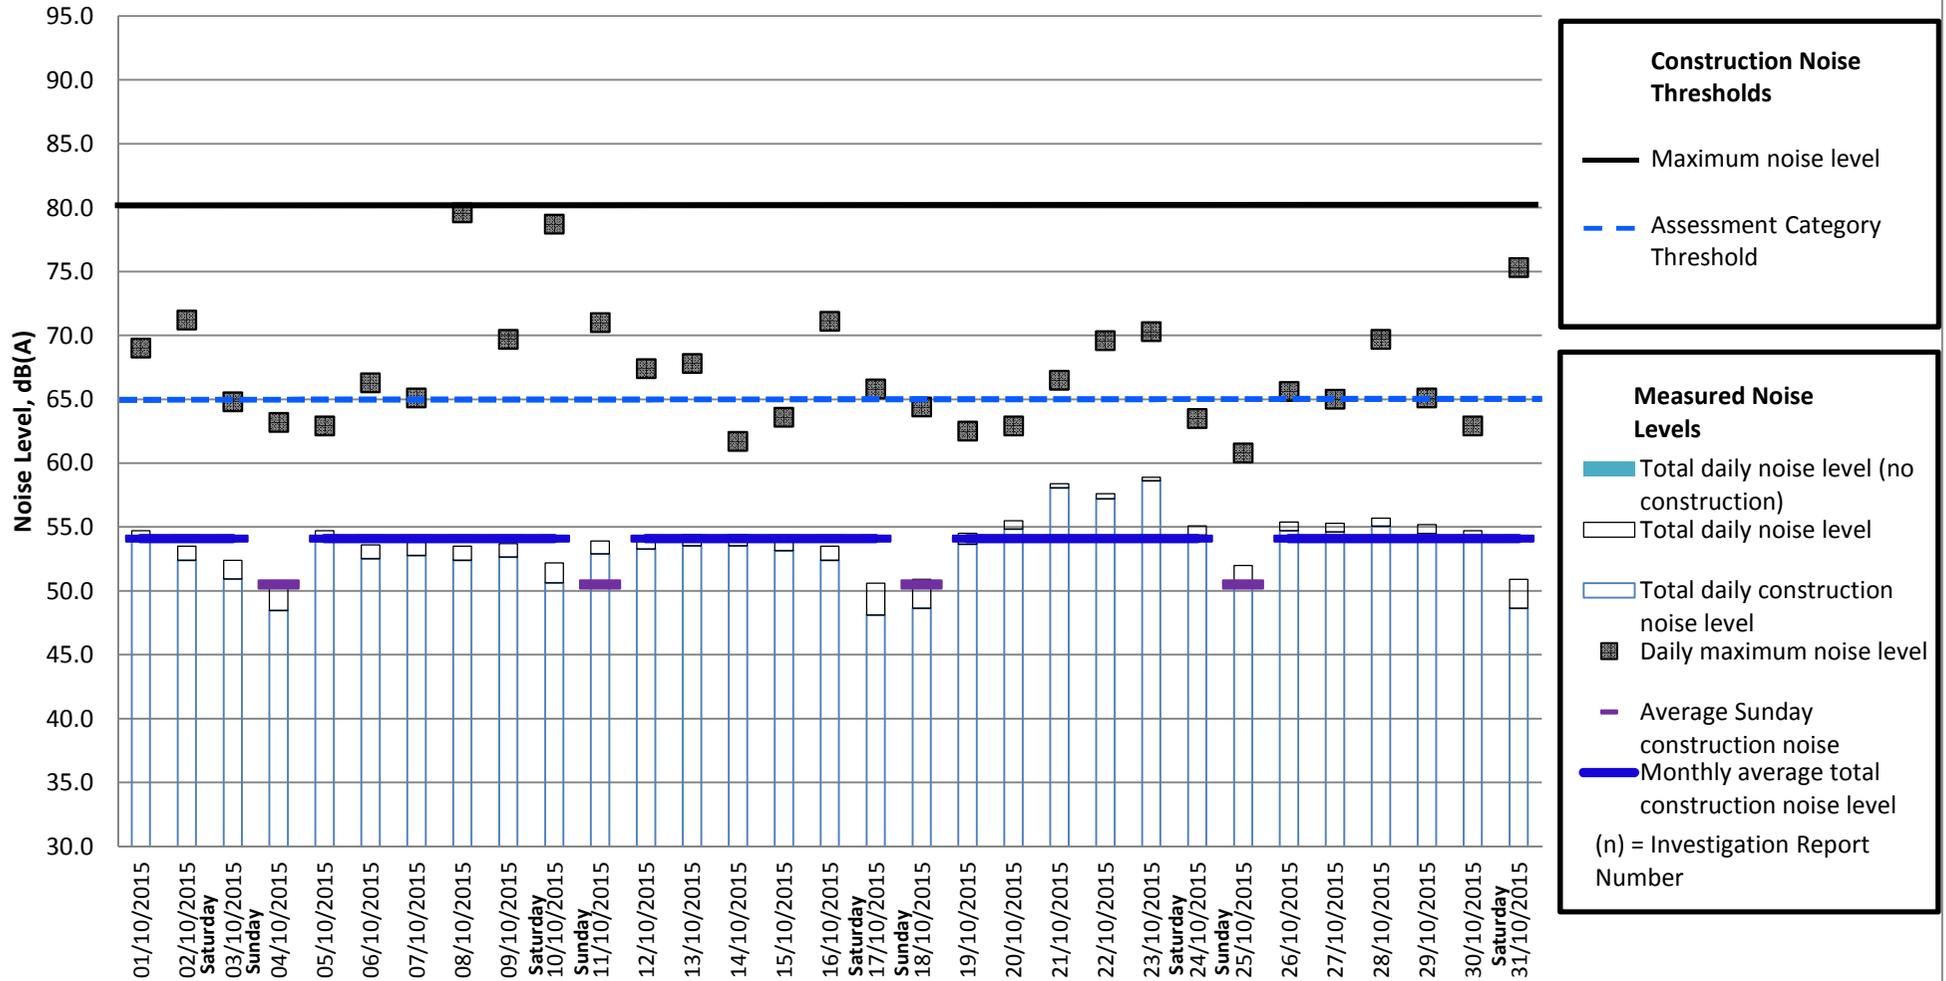


Measured Night time Noise Levels at Tigh-Na-Grian Measurement period: October 2015

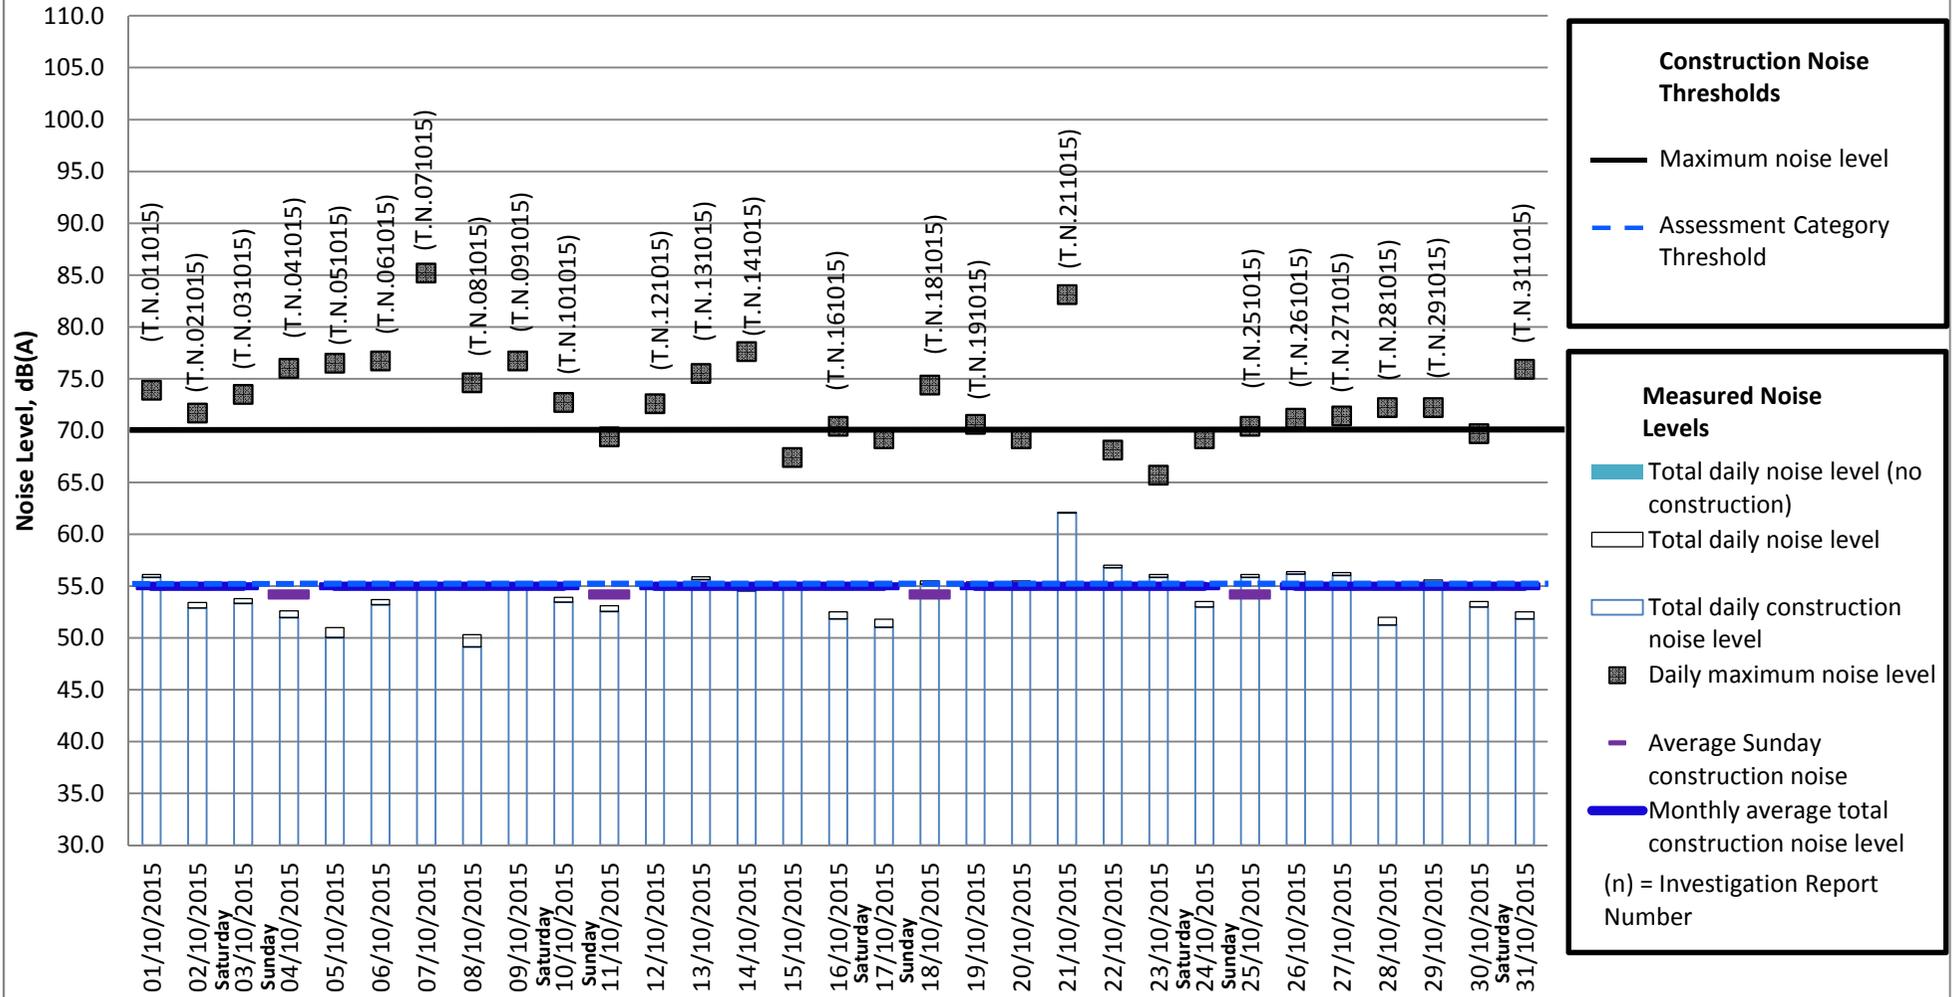


Note: After investigation, it was concluded that the exceedances of the LAeq 'Total Daily Construction' on the 21st was caused by high winds

Measured Daytime Noise Levels at Dundas Home Farm Measurement period: October 2015

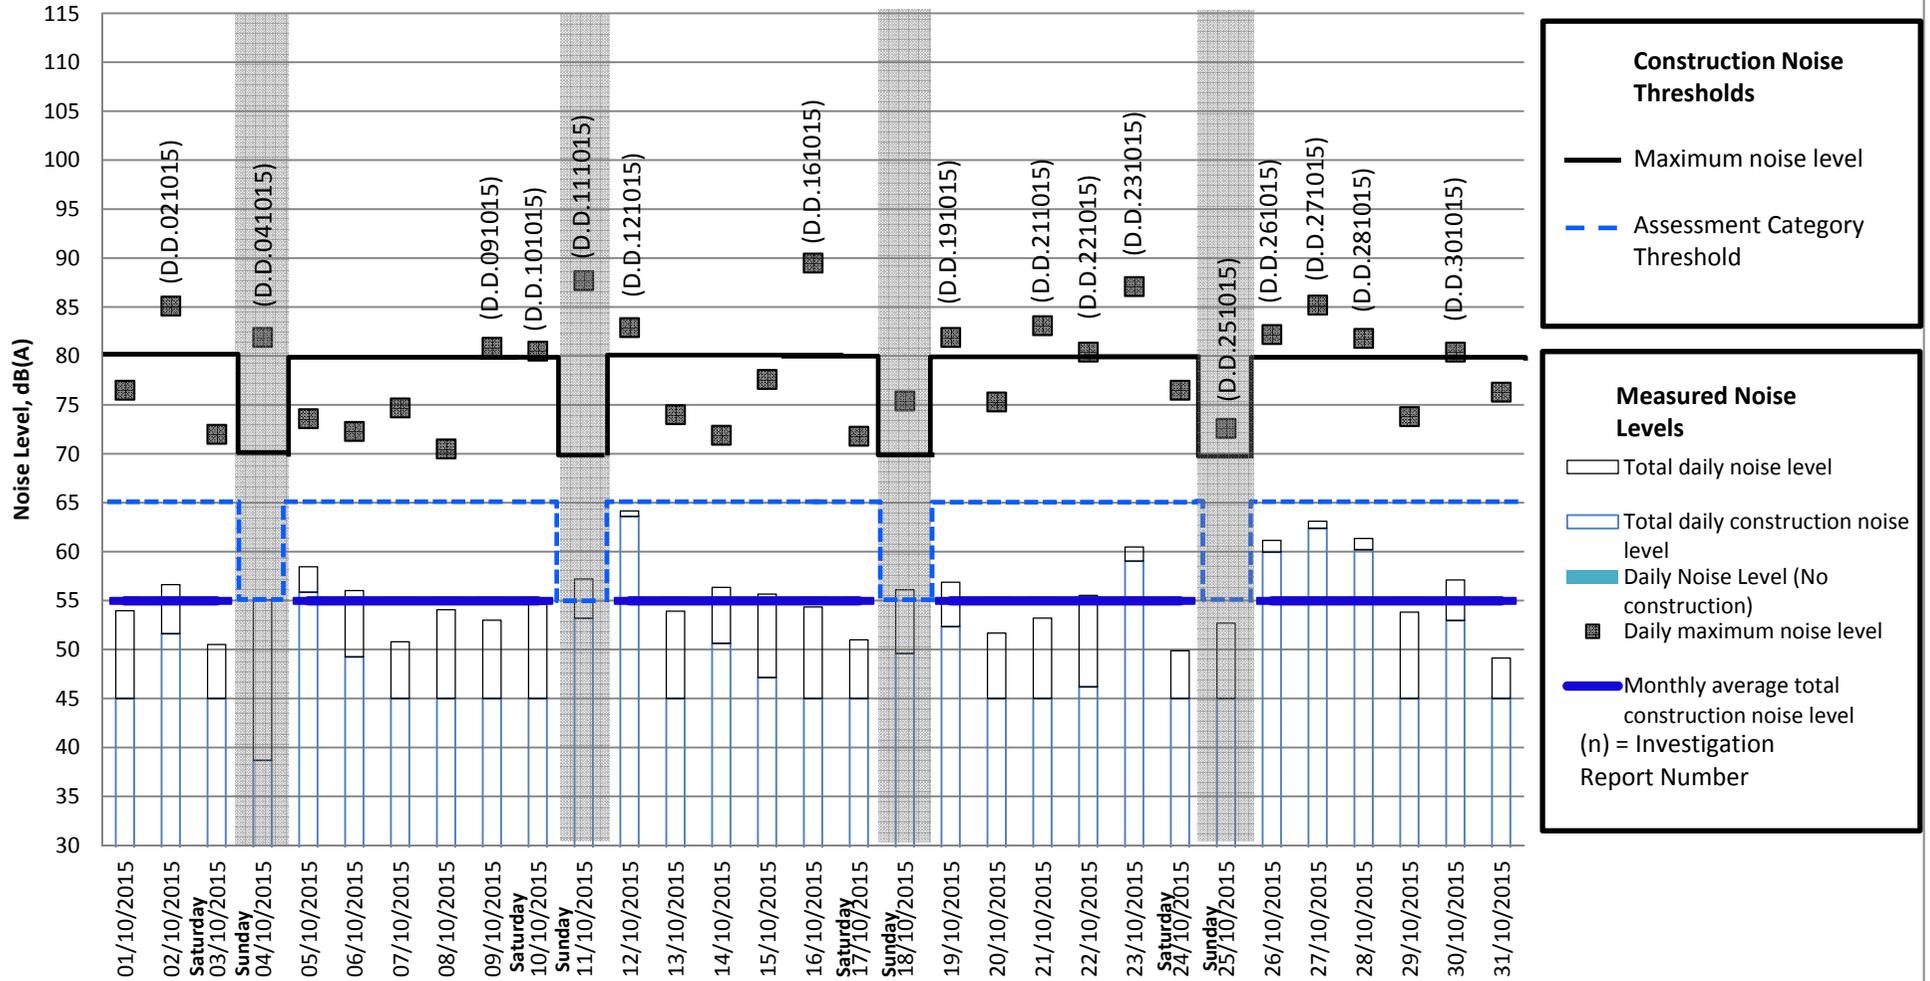


Note: The grey areas of the chart represent days on which no construction works have been conducted.

Measured Evening Noise Levels at Dundas Home Farm Measurement period: October 2015

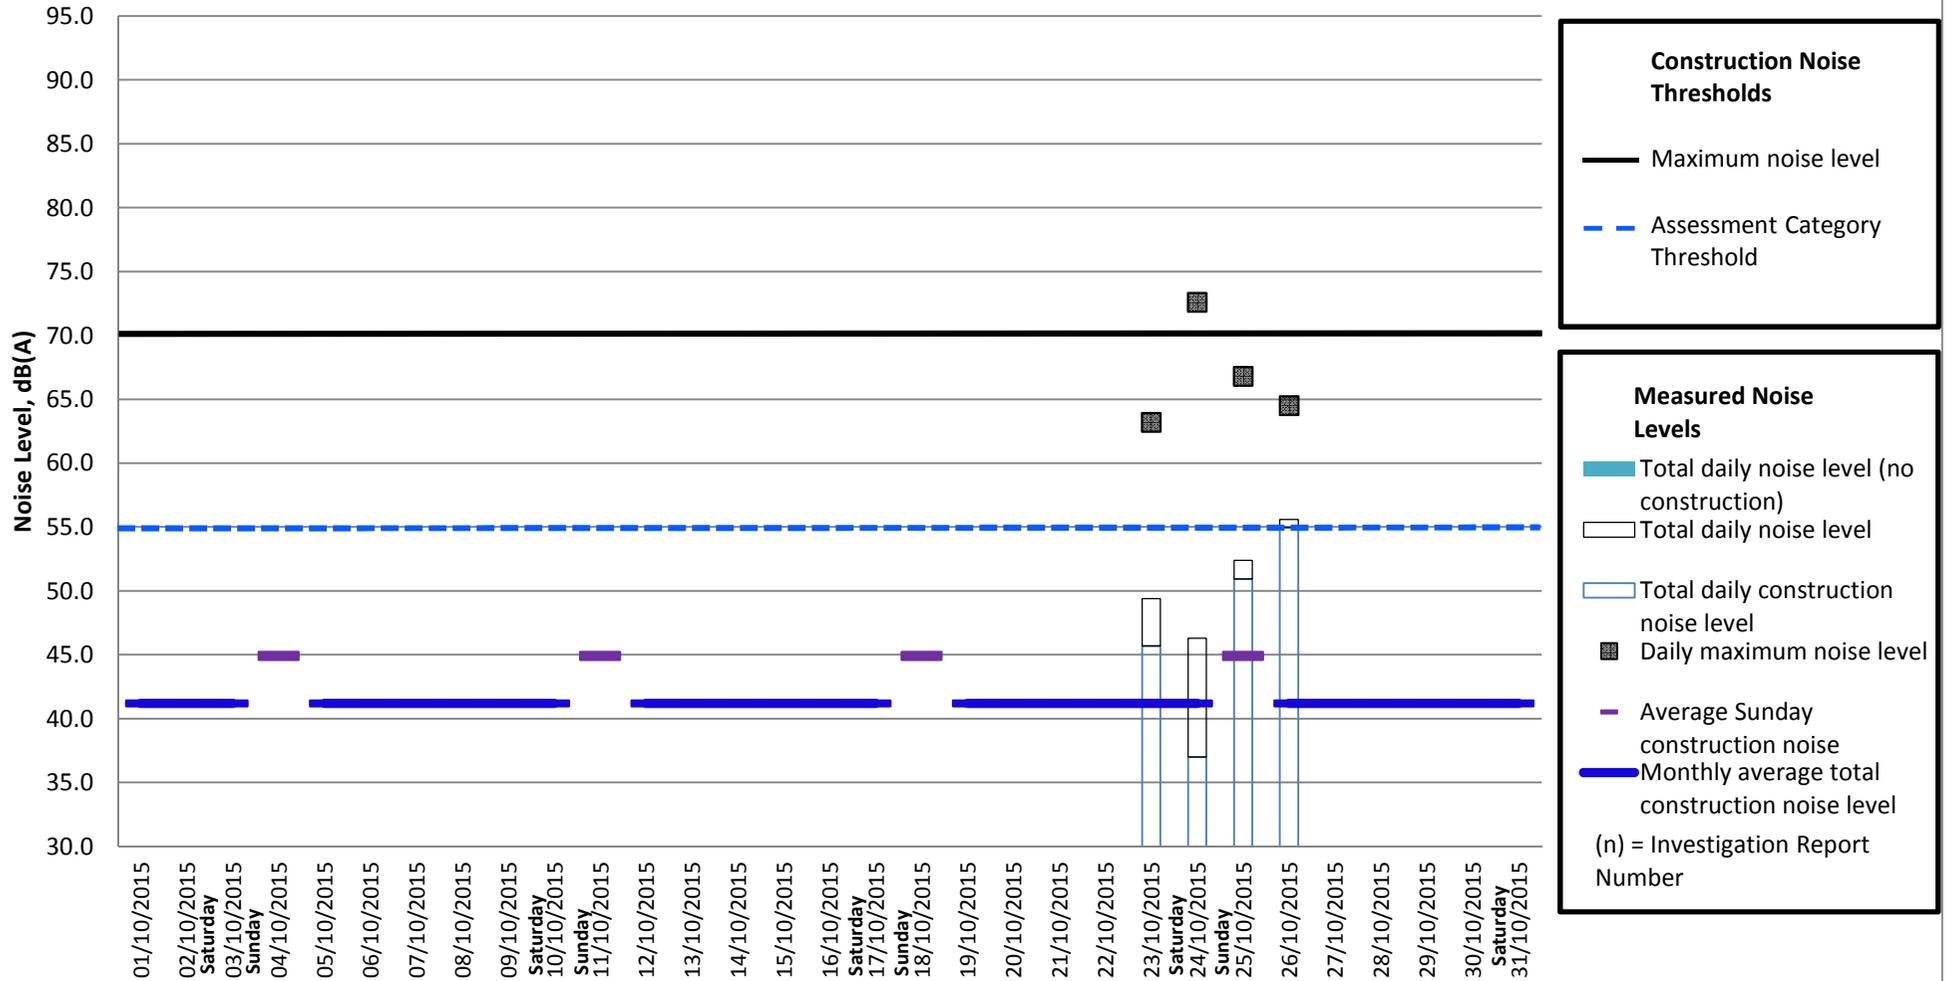


Note; The B800 bridge demolition took place over from 24/10/2015 at 22:00 until 26/10/2015 at 07:00. Noise levels have been included if for this month

Measured Night time Noise Levels at Dundas Home Farm Measurement period: October 2015

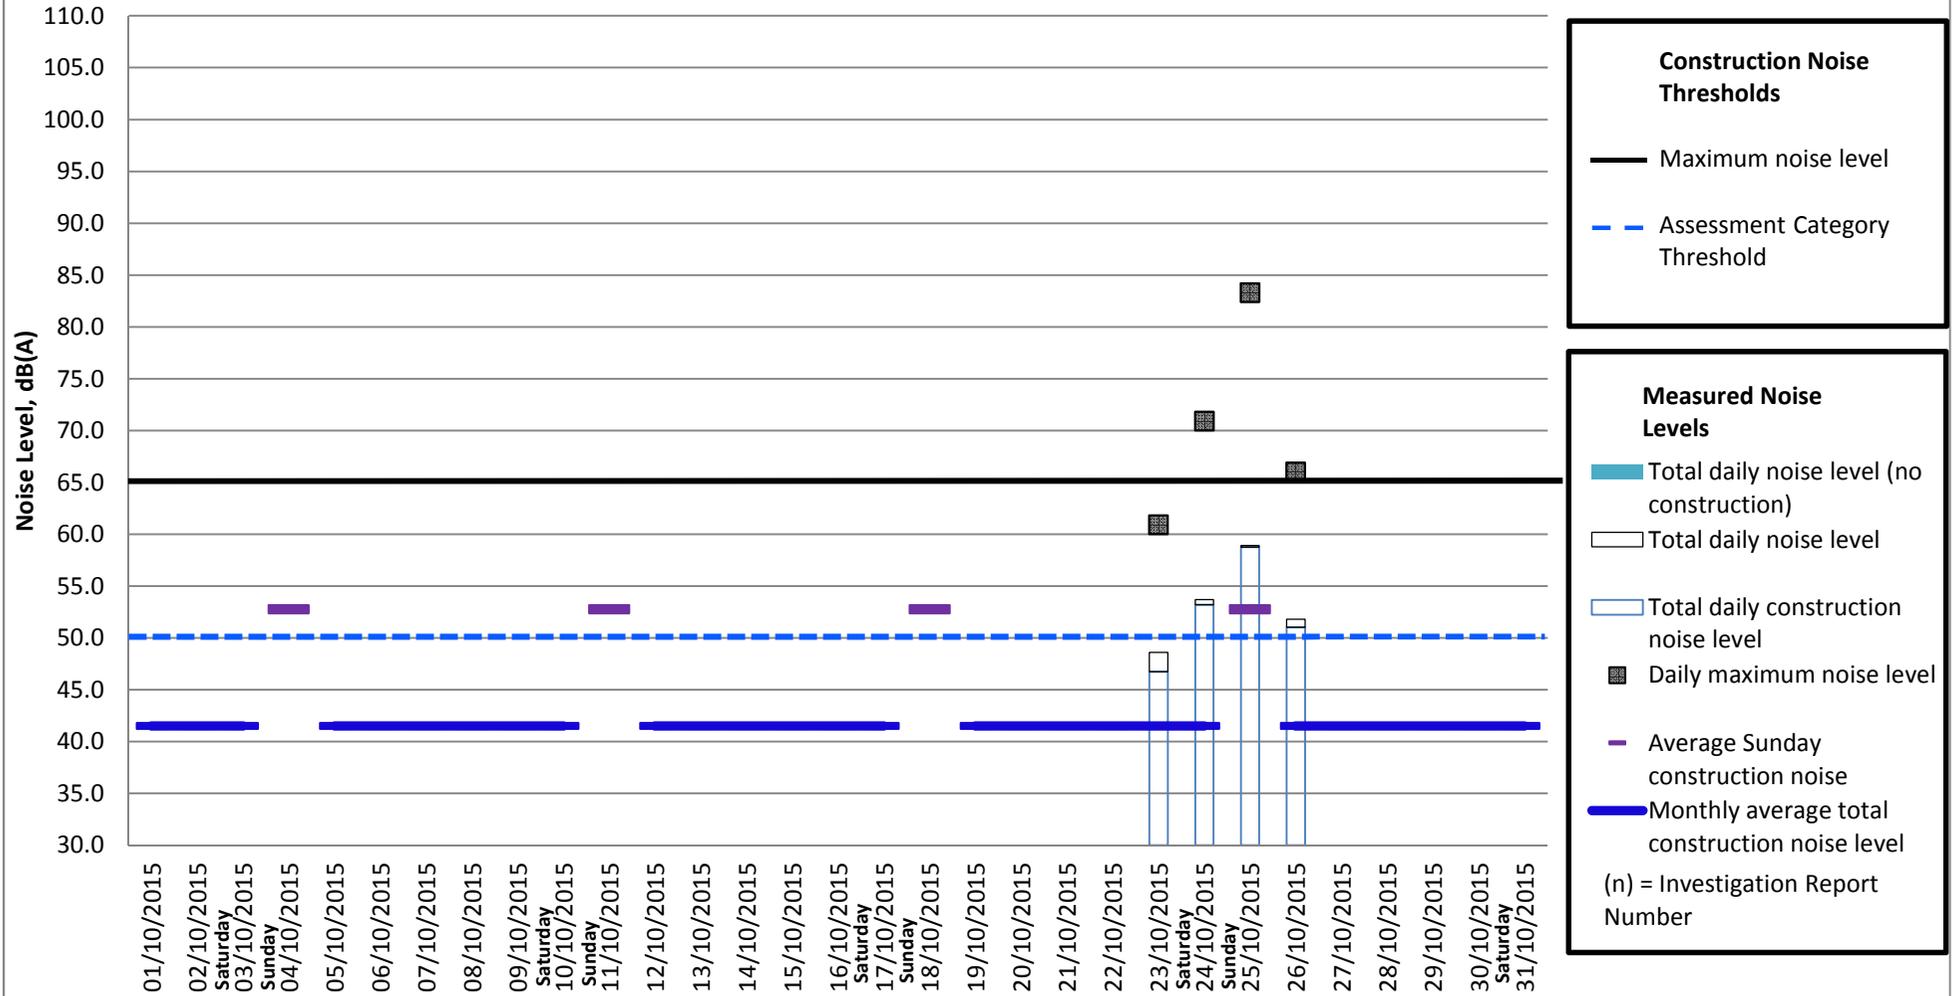


Note; The B800 bridge demolition took place over from 24/10/2015 at 22:00 until 26/10/2015 at 07:00. Noise levels have been included ifor this month

Measured Daytime Noise Levels at Echline Measurement period: October 2015

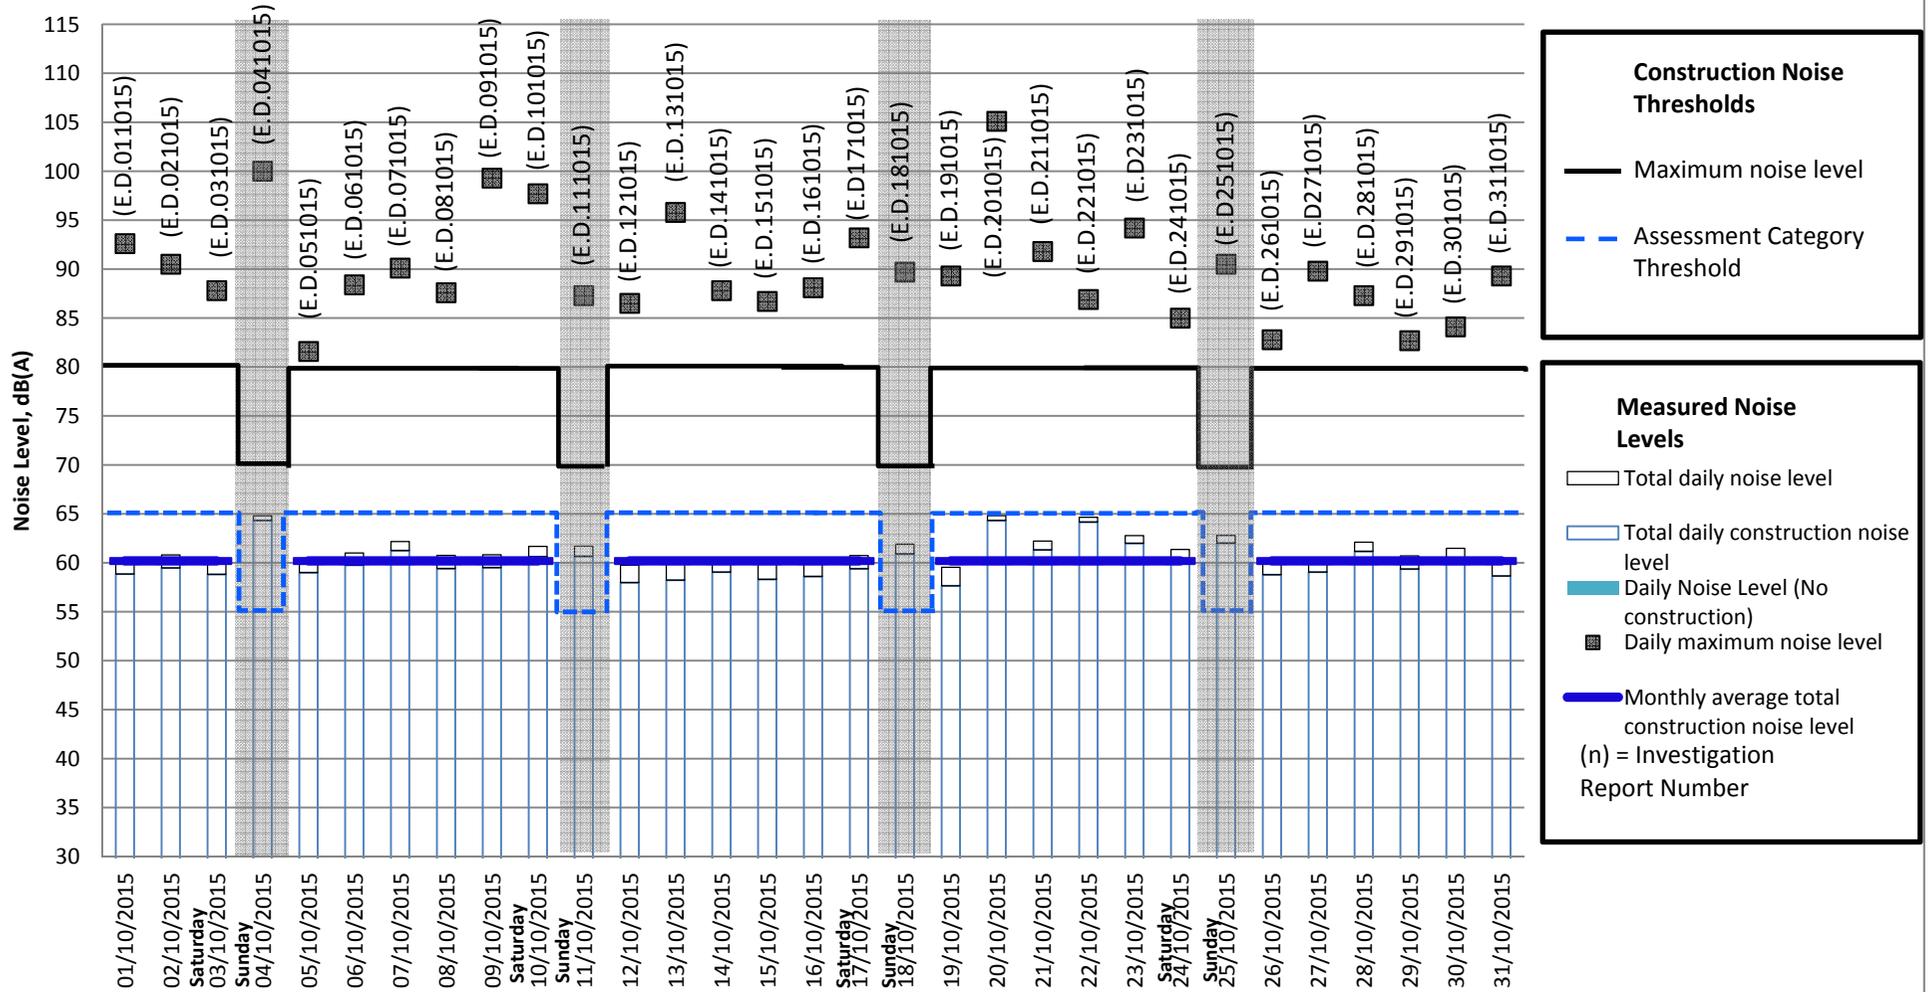

Note: The grey areas of the chart represent days on which no construction works have been conducted.


Measured Daytime Noise Levels at Springfield Measurement period: October 2015

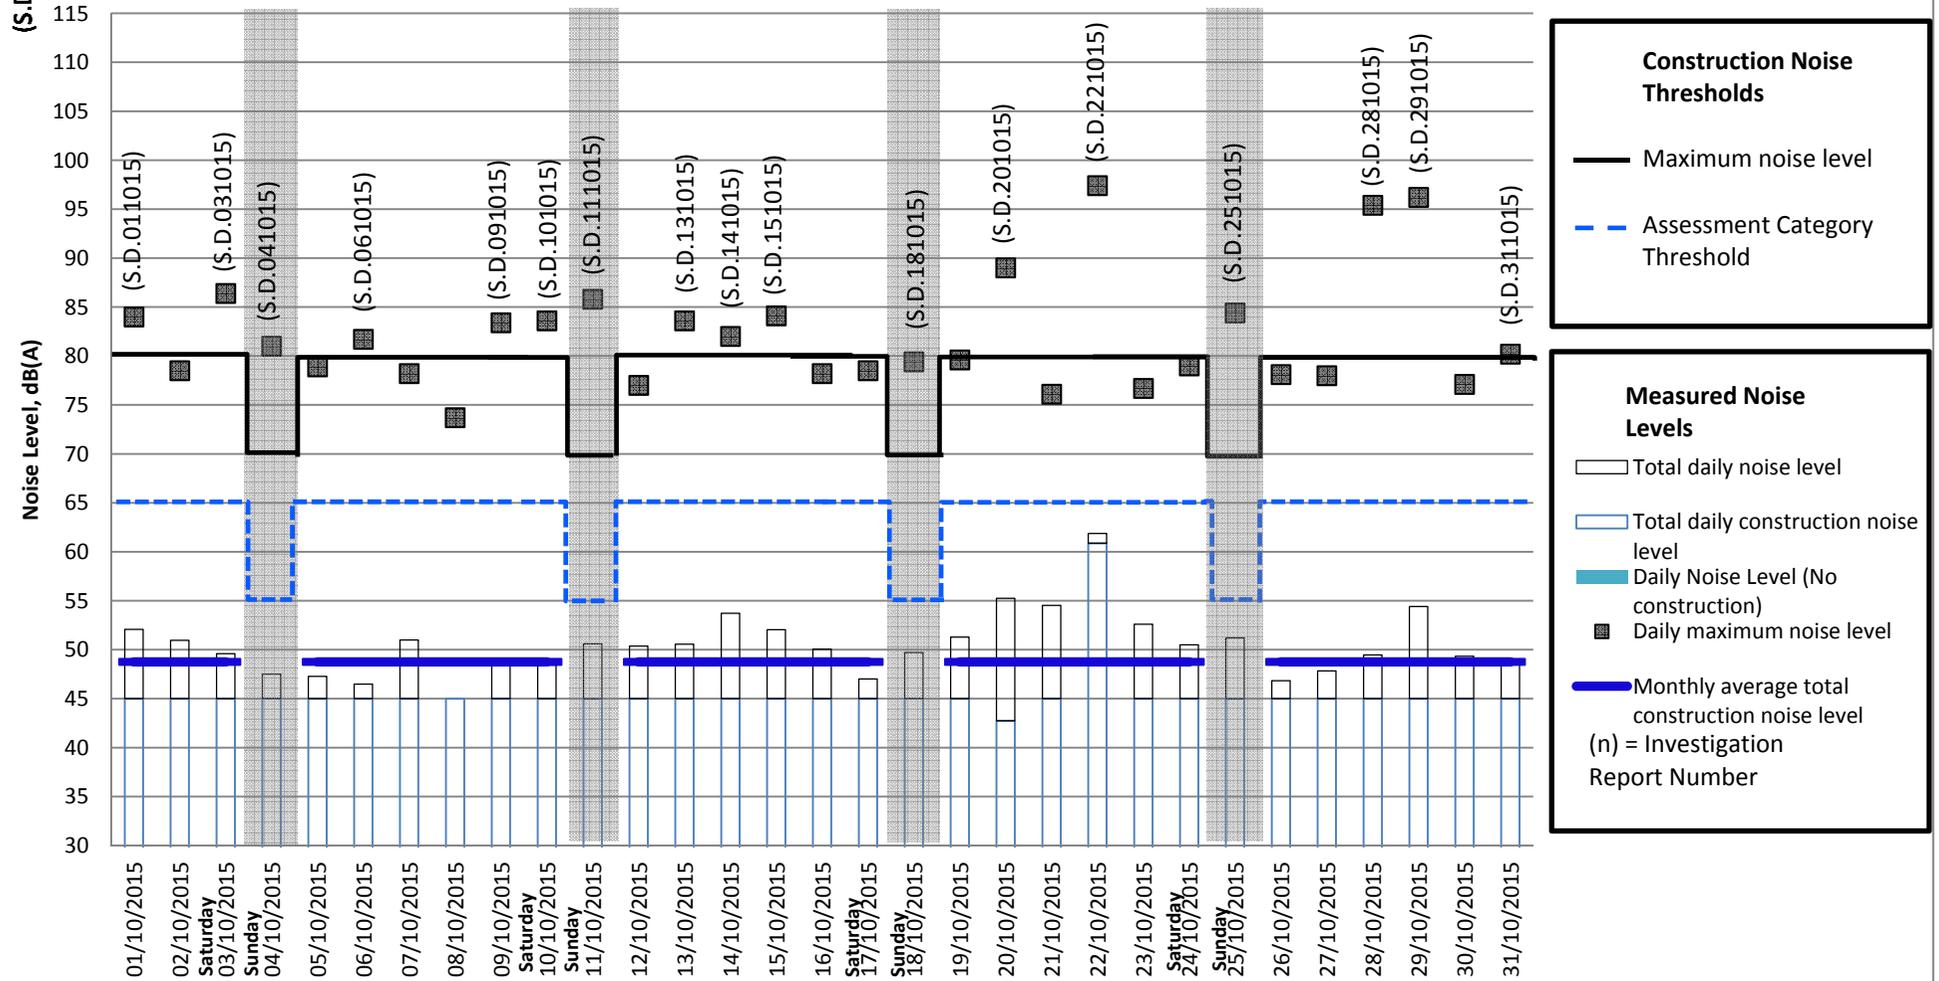

Note: The grey areas of the chart represent days on which no construction works have been conducted.


Measured Daytime Noise Levels at Scotstoun

Measurement period: October 2015

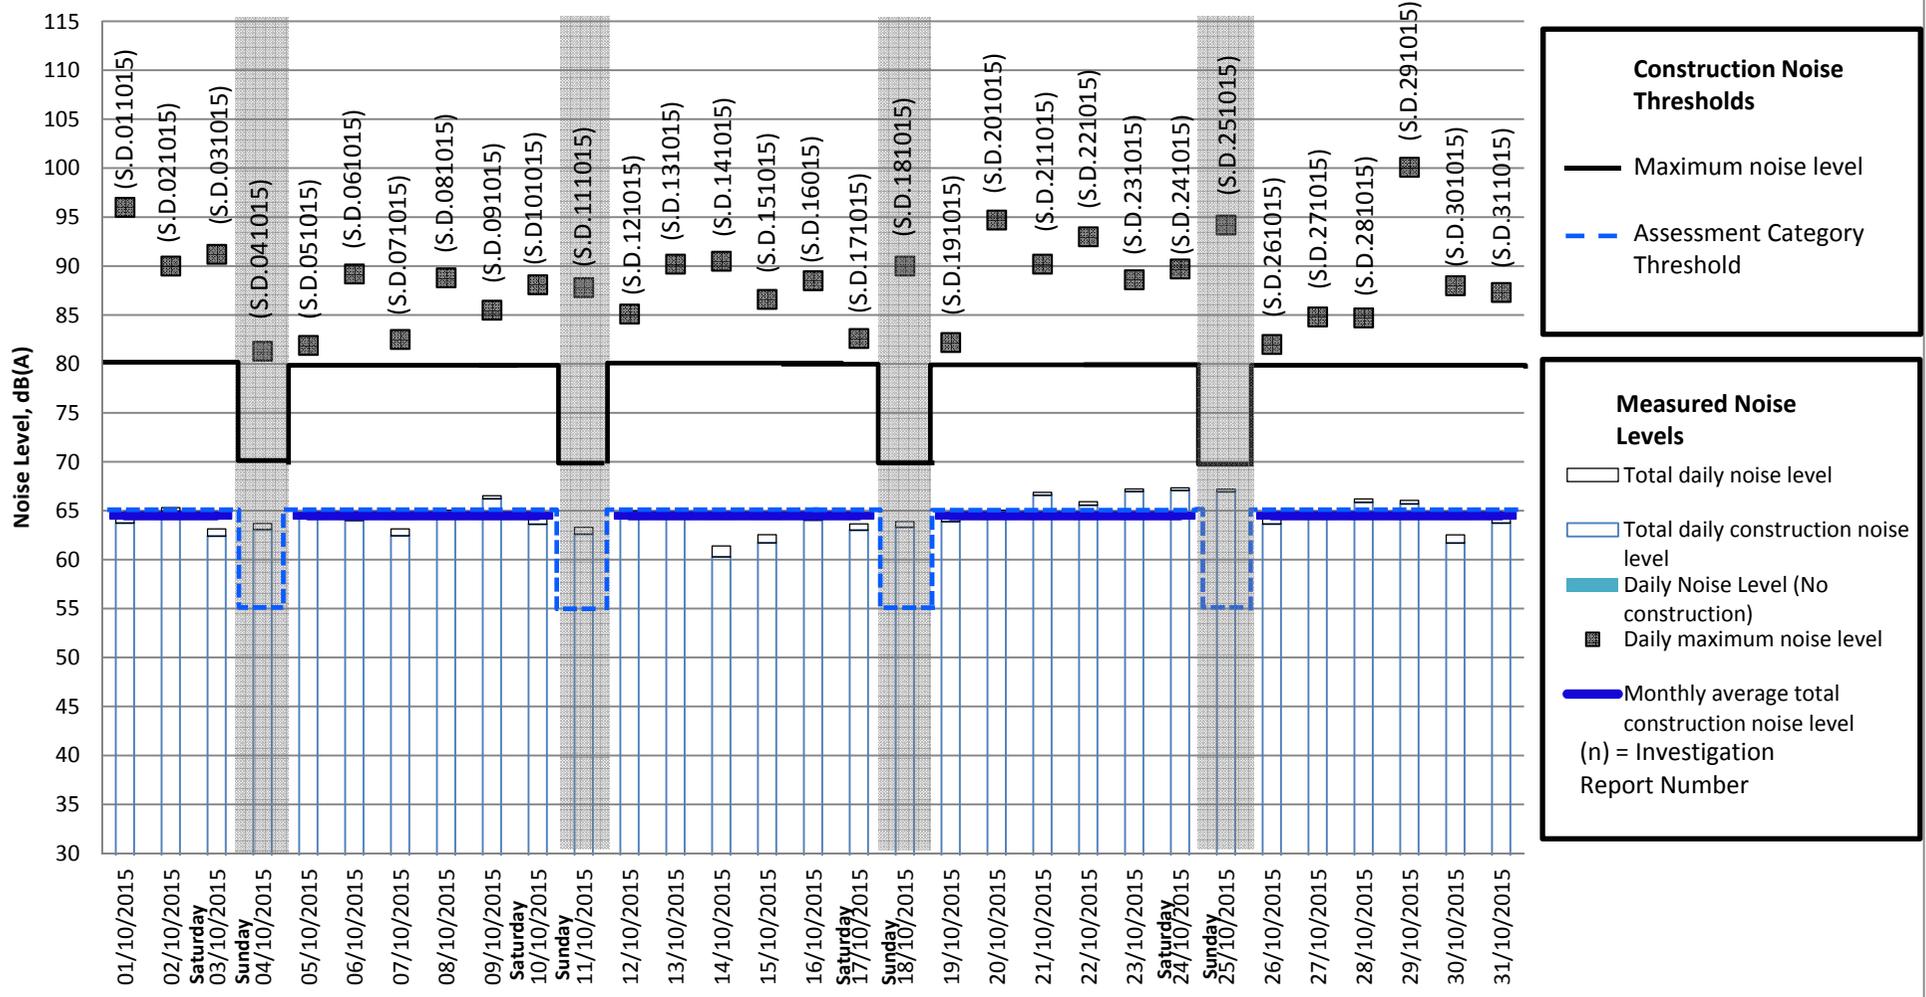


Note: The grey areas of the chart represent days on which no construction works have been conducted.

Measured Evening Noise Scotstoun Measurement period: October 2015

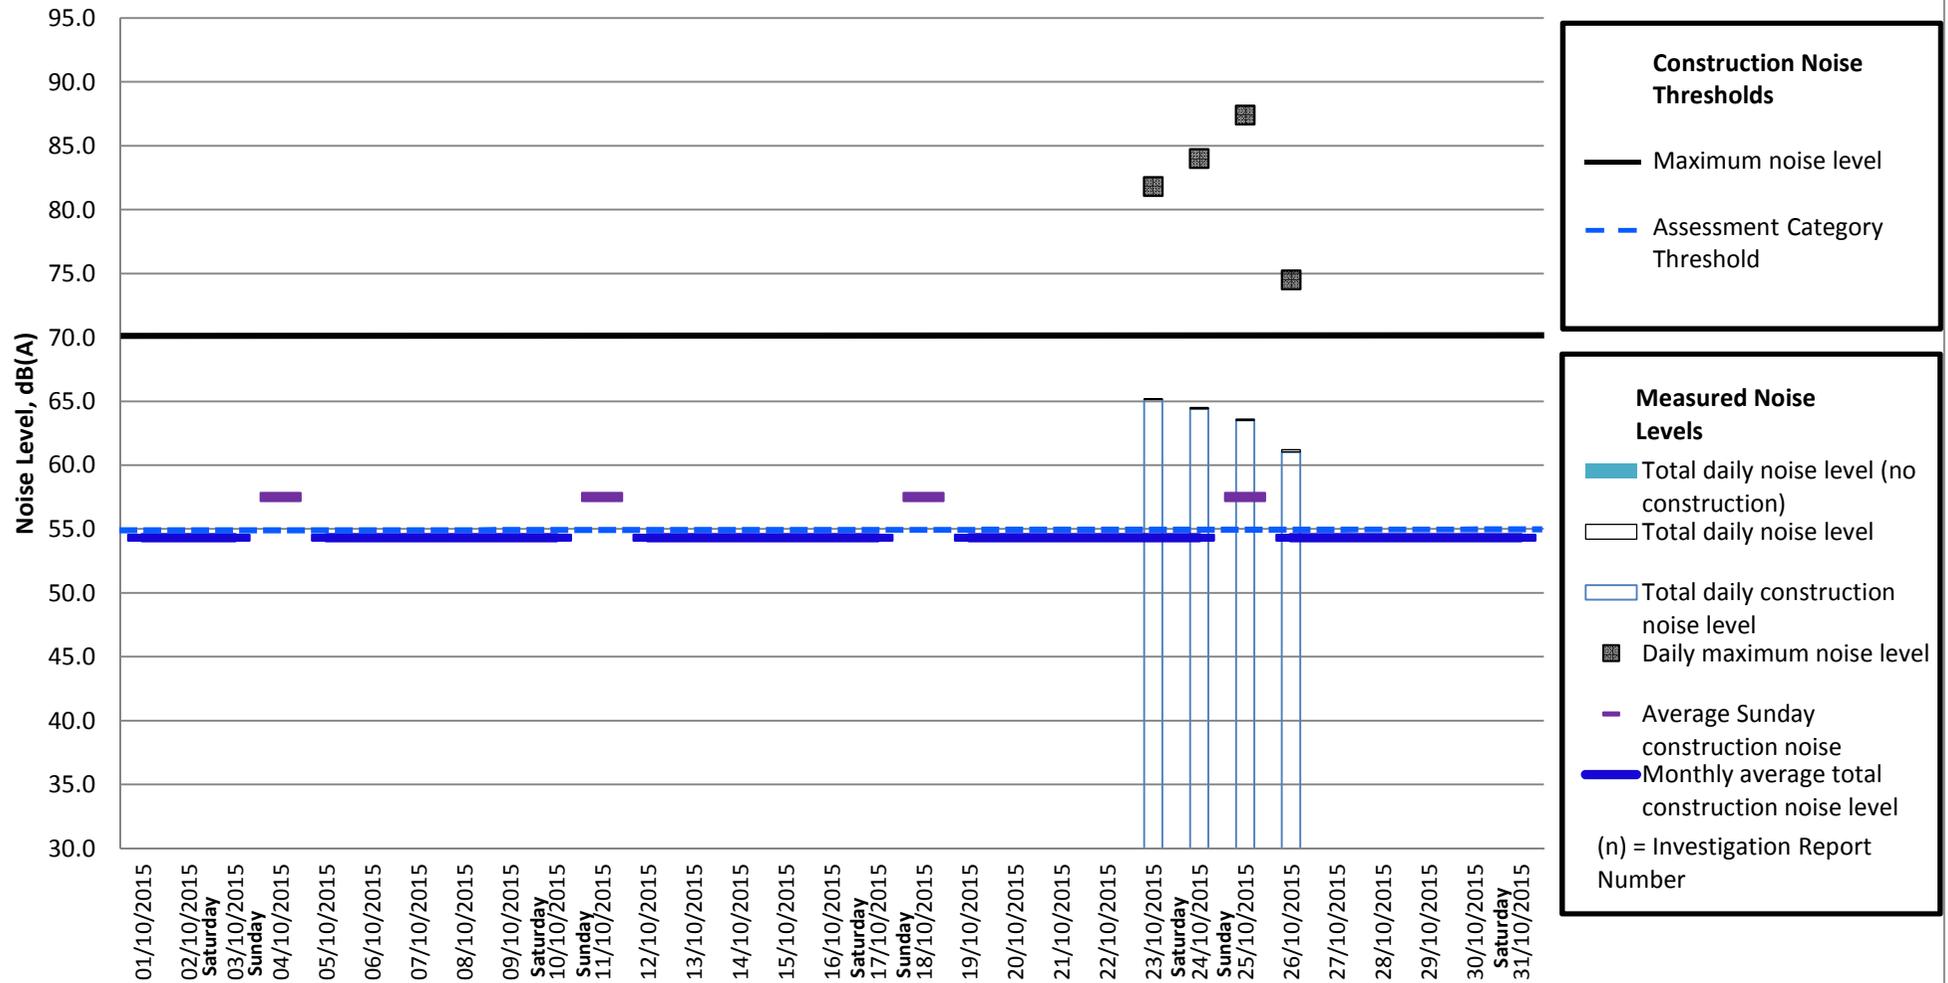


Note; The B800 bridge demolition took place over from 24/10/2015 at 22:00 until 26/10/2015 at 07:00. Noise levels have been included ifor this month

Measured Night time Noise Levels at Scotstoun Measurement period: October 2015

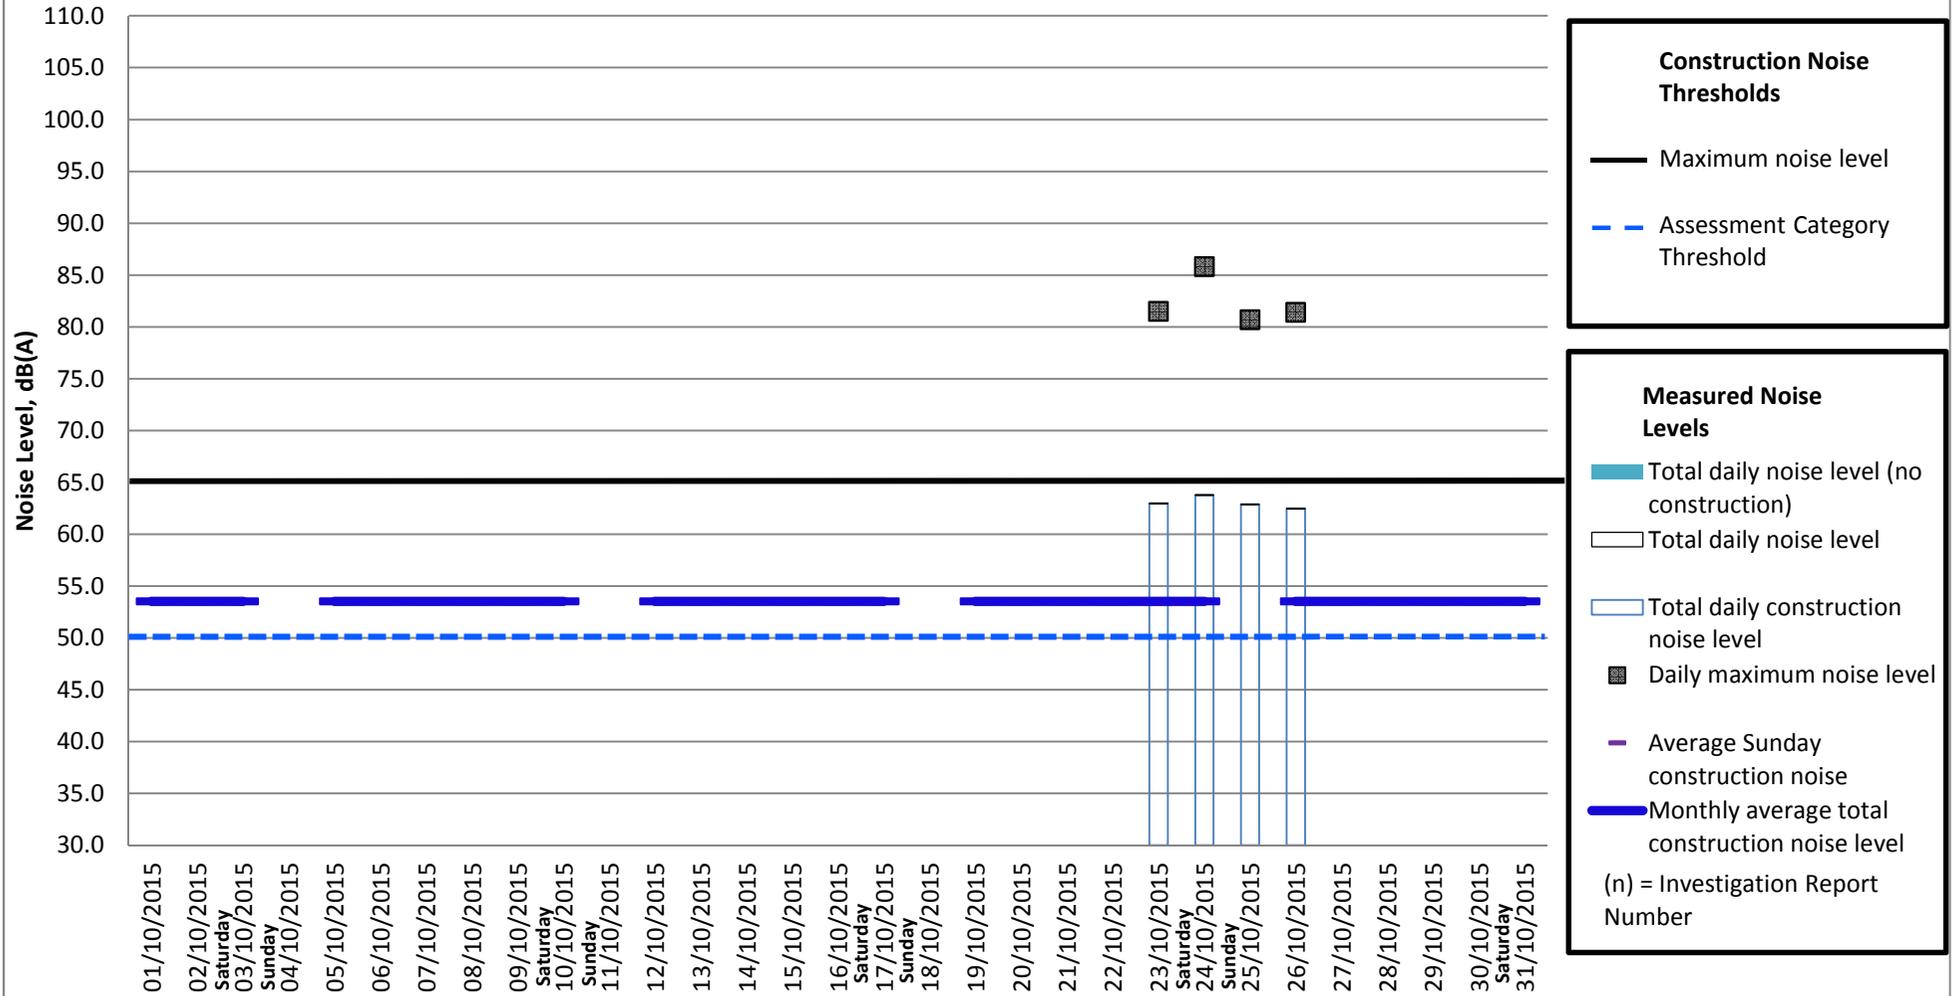


Note; The B800 bridge demolition took place over from 24/10/2015 at 22:00 until 26/10/2015 at 07:00. Noise levels have been included ifor this month

Measured Daytime Noise Levels at Whinnyhill Measurement period: October 2015

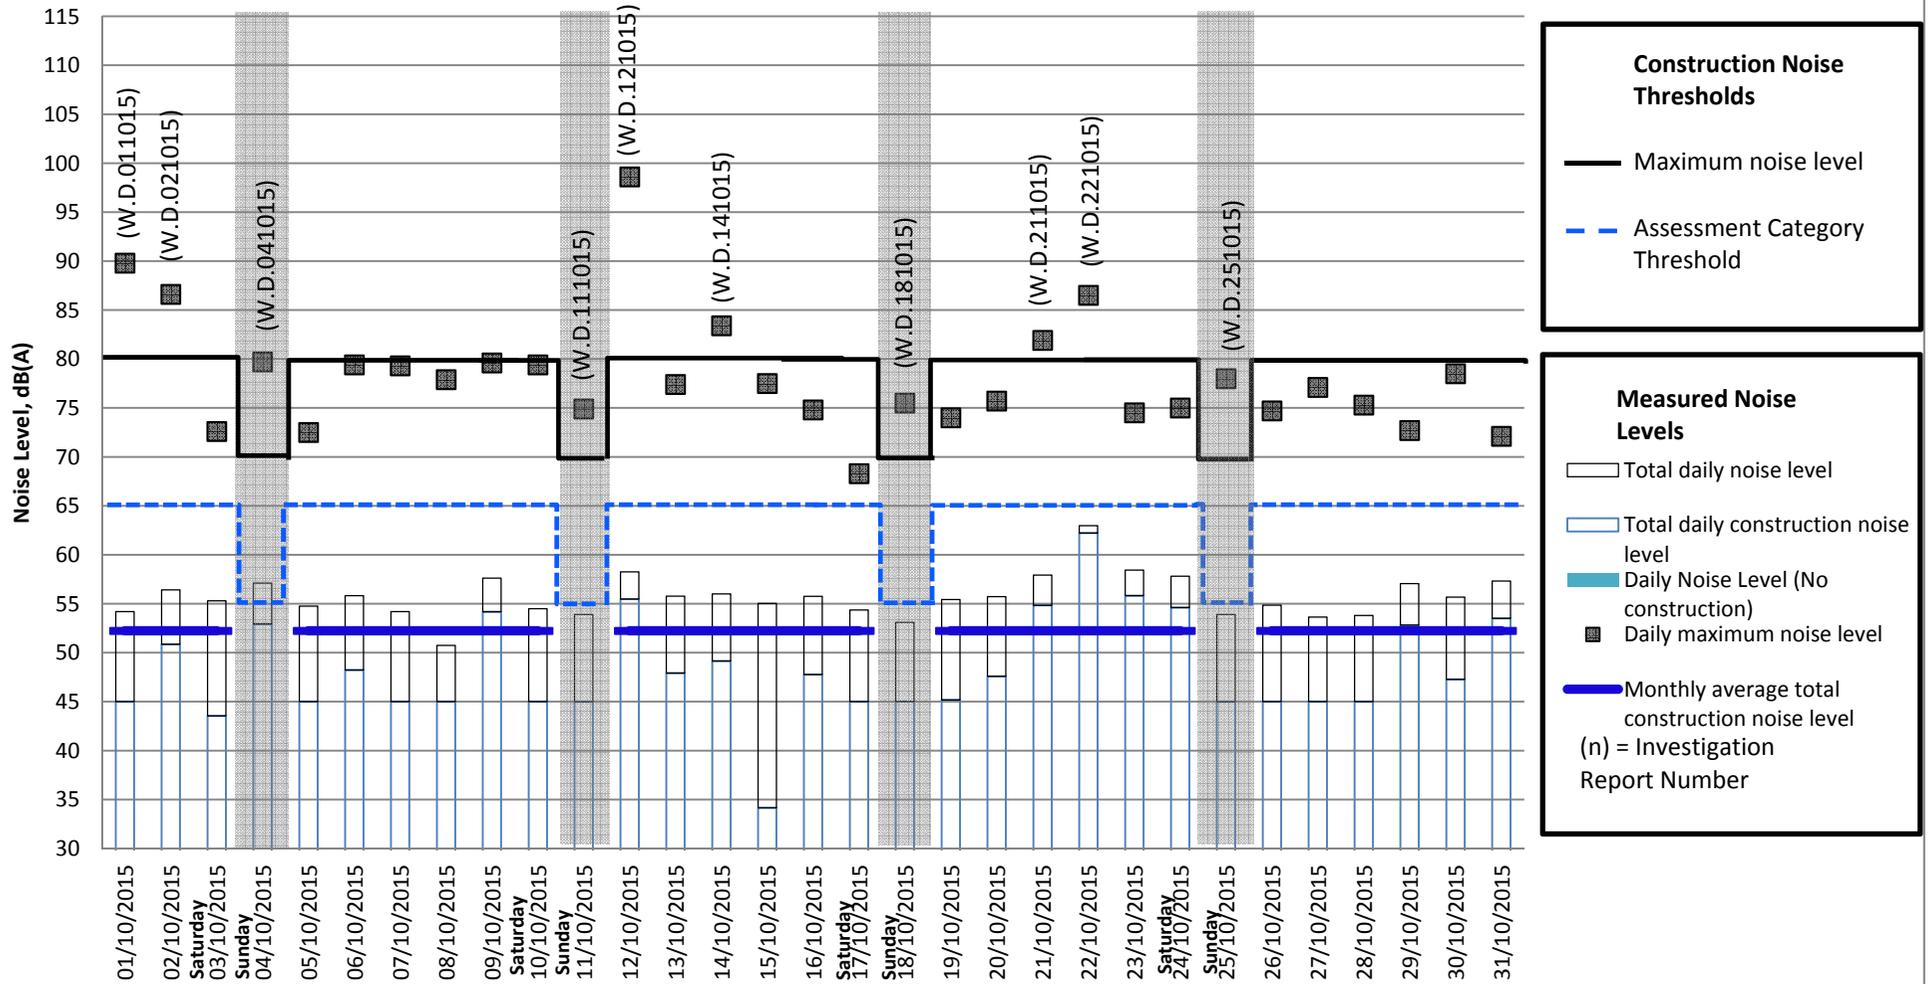


Note: The grey areas of the chart represent days on which no construction works have been conducted.

Measured Daytime Noise Levels at Newton Measurement period: October 2015

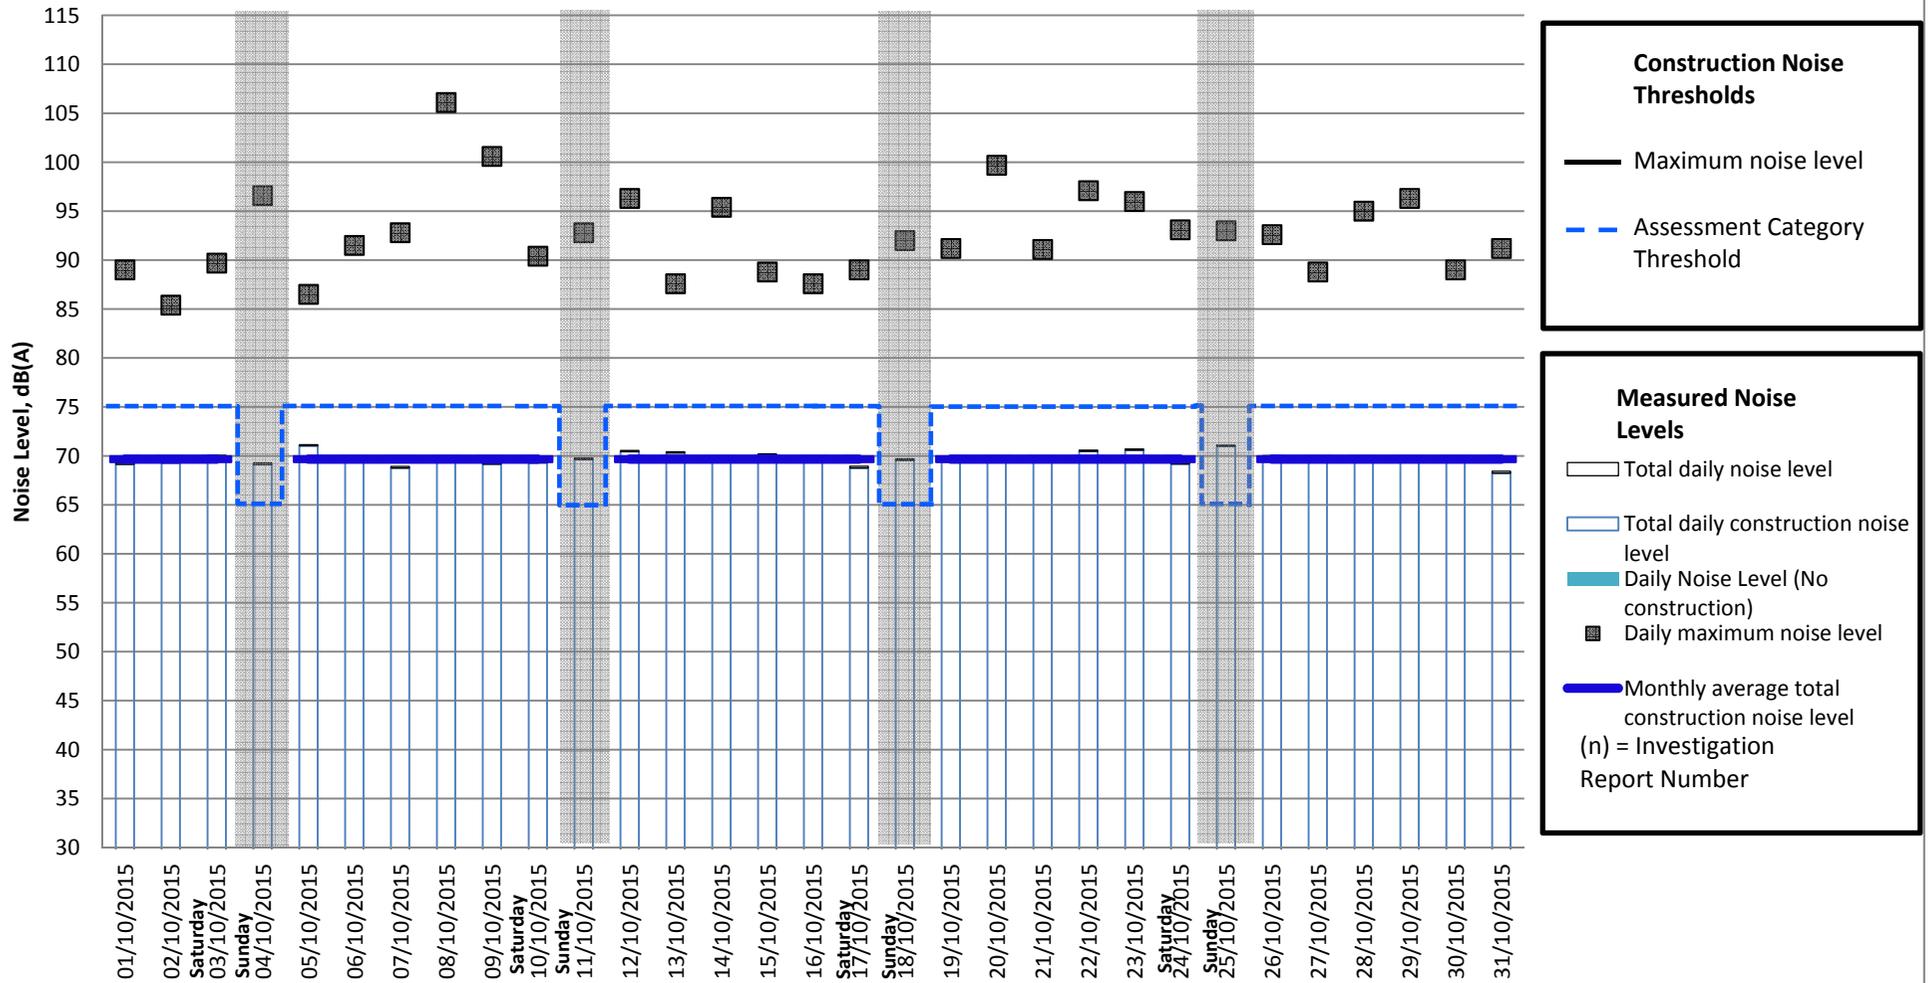


Note: The grey areas of the chart represent days on which no construction works have been conducted. It should be noted that the measured noise levels Mon - Fri can not be attributed to construction works due to the considerable distance (1.75 kilometers) between this monitoring location and the closest construction works.

Measured Daytime Noise Levels at Port Edgar Measurement period: October 2015

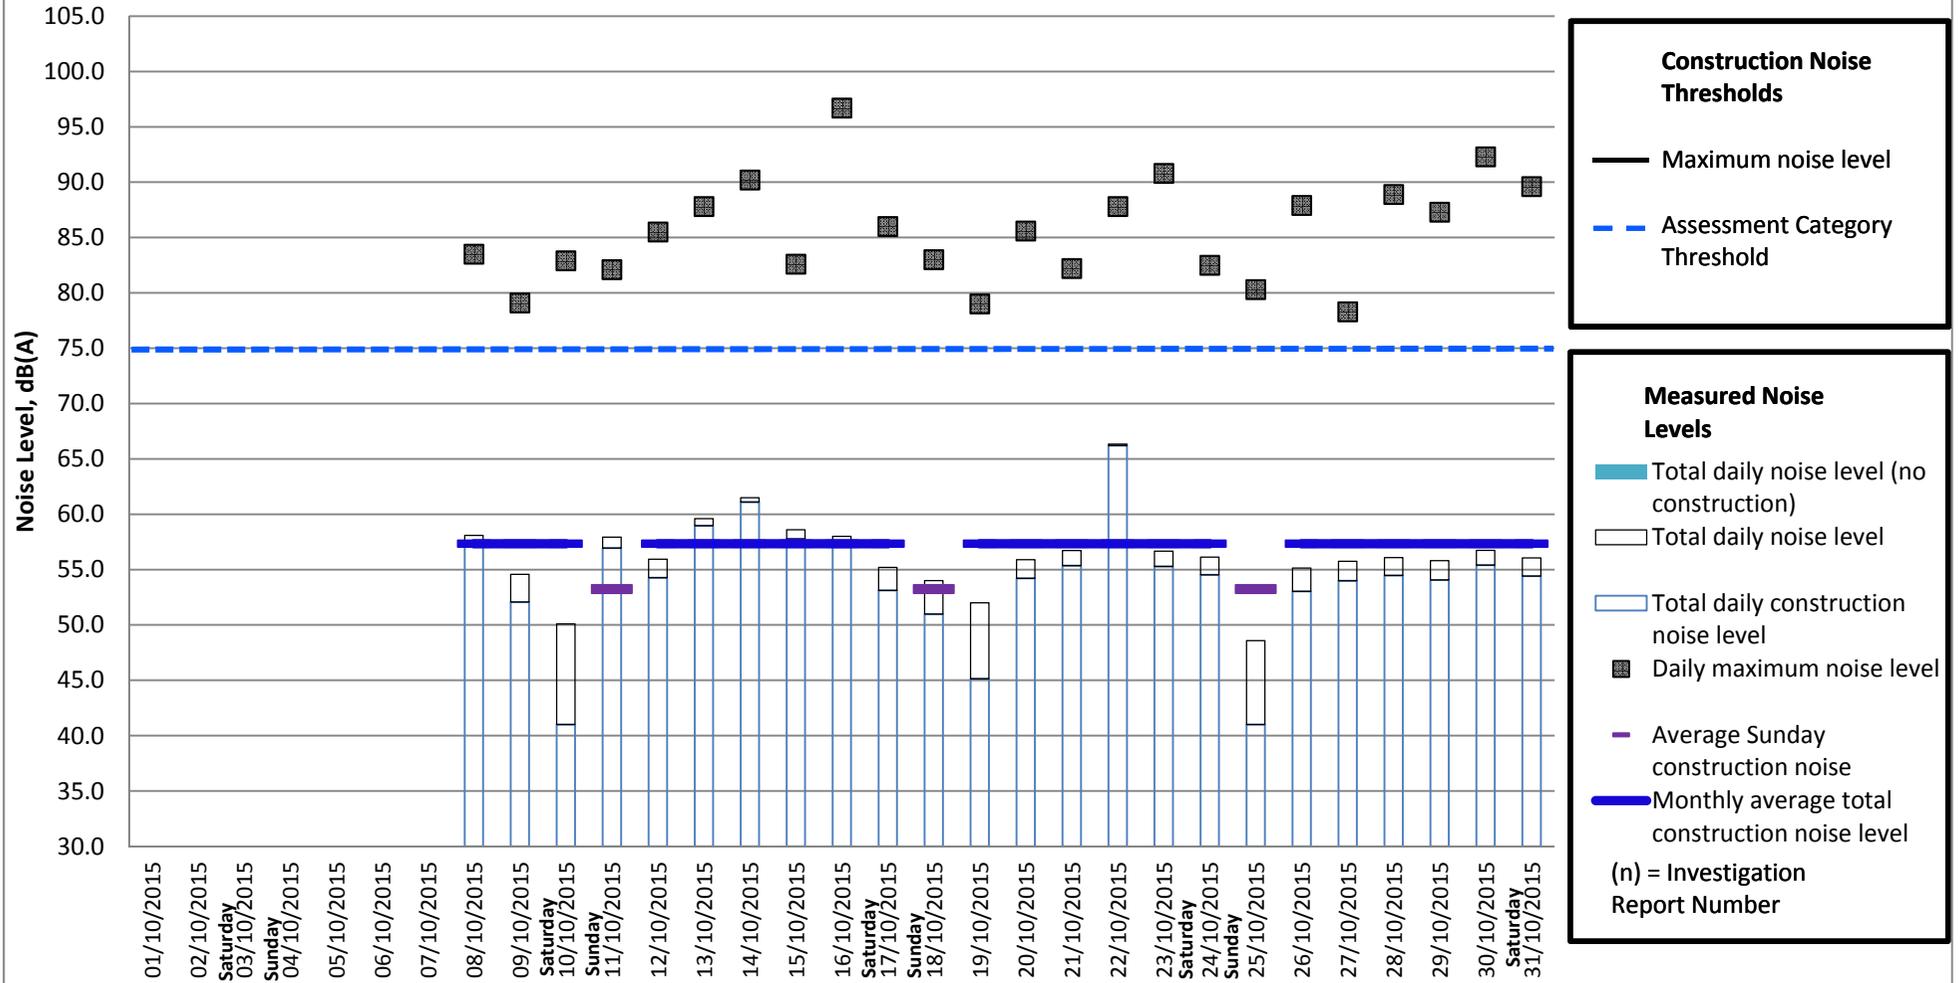


Note: There is no data before 08/10/2015 due to a problem with the monitor

Measured Evening Noise Levels at Port Edgar Measurement period: October 2015

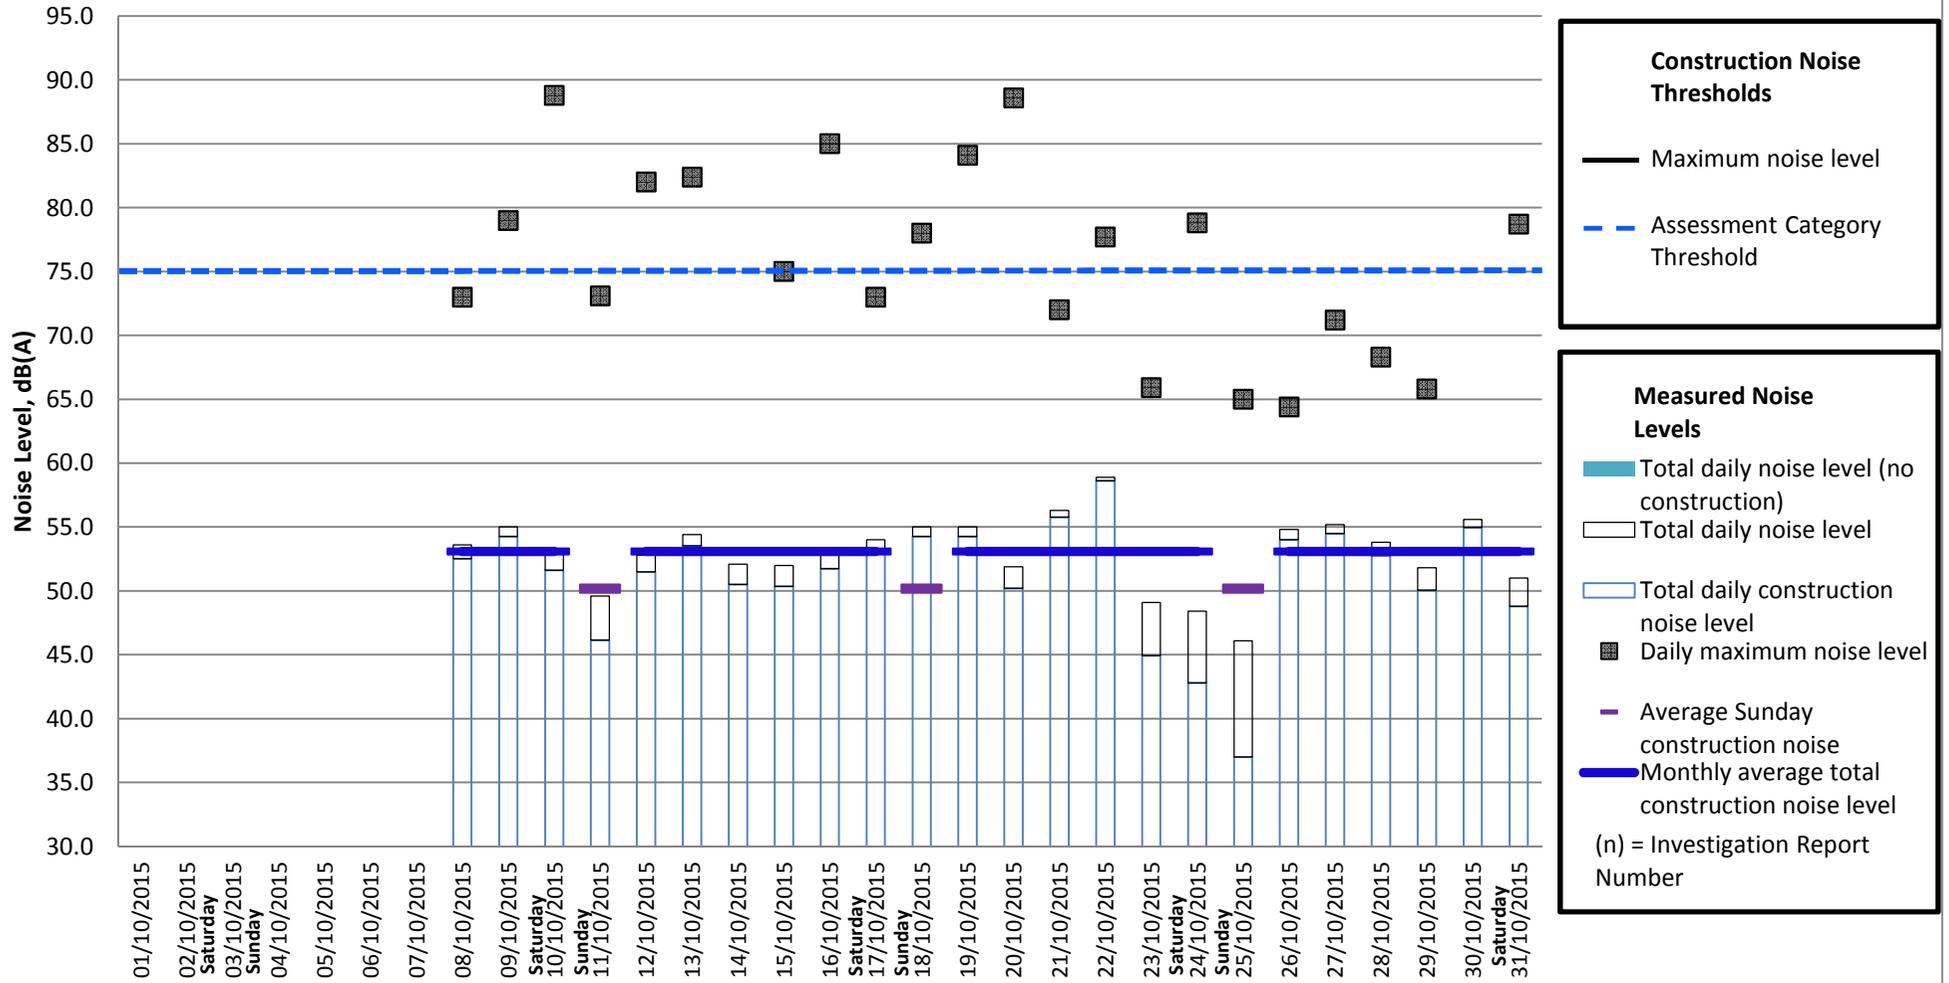

Note: There is no data before 08/10/2015 due to a problem with the monitor

Measured Night time Noise Levels at Port Edgar Measurement period: October 2015

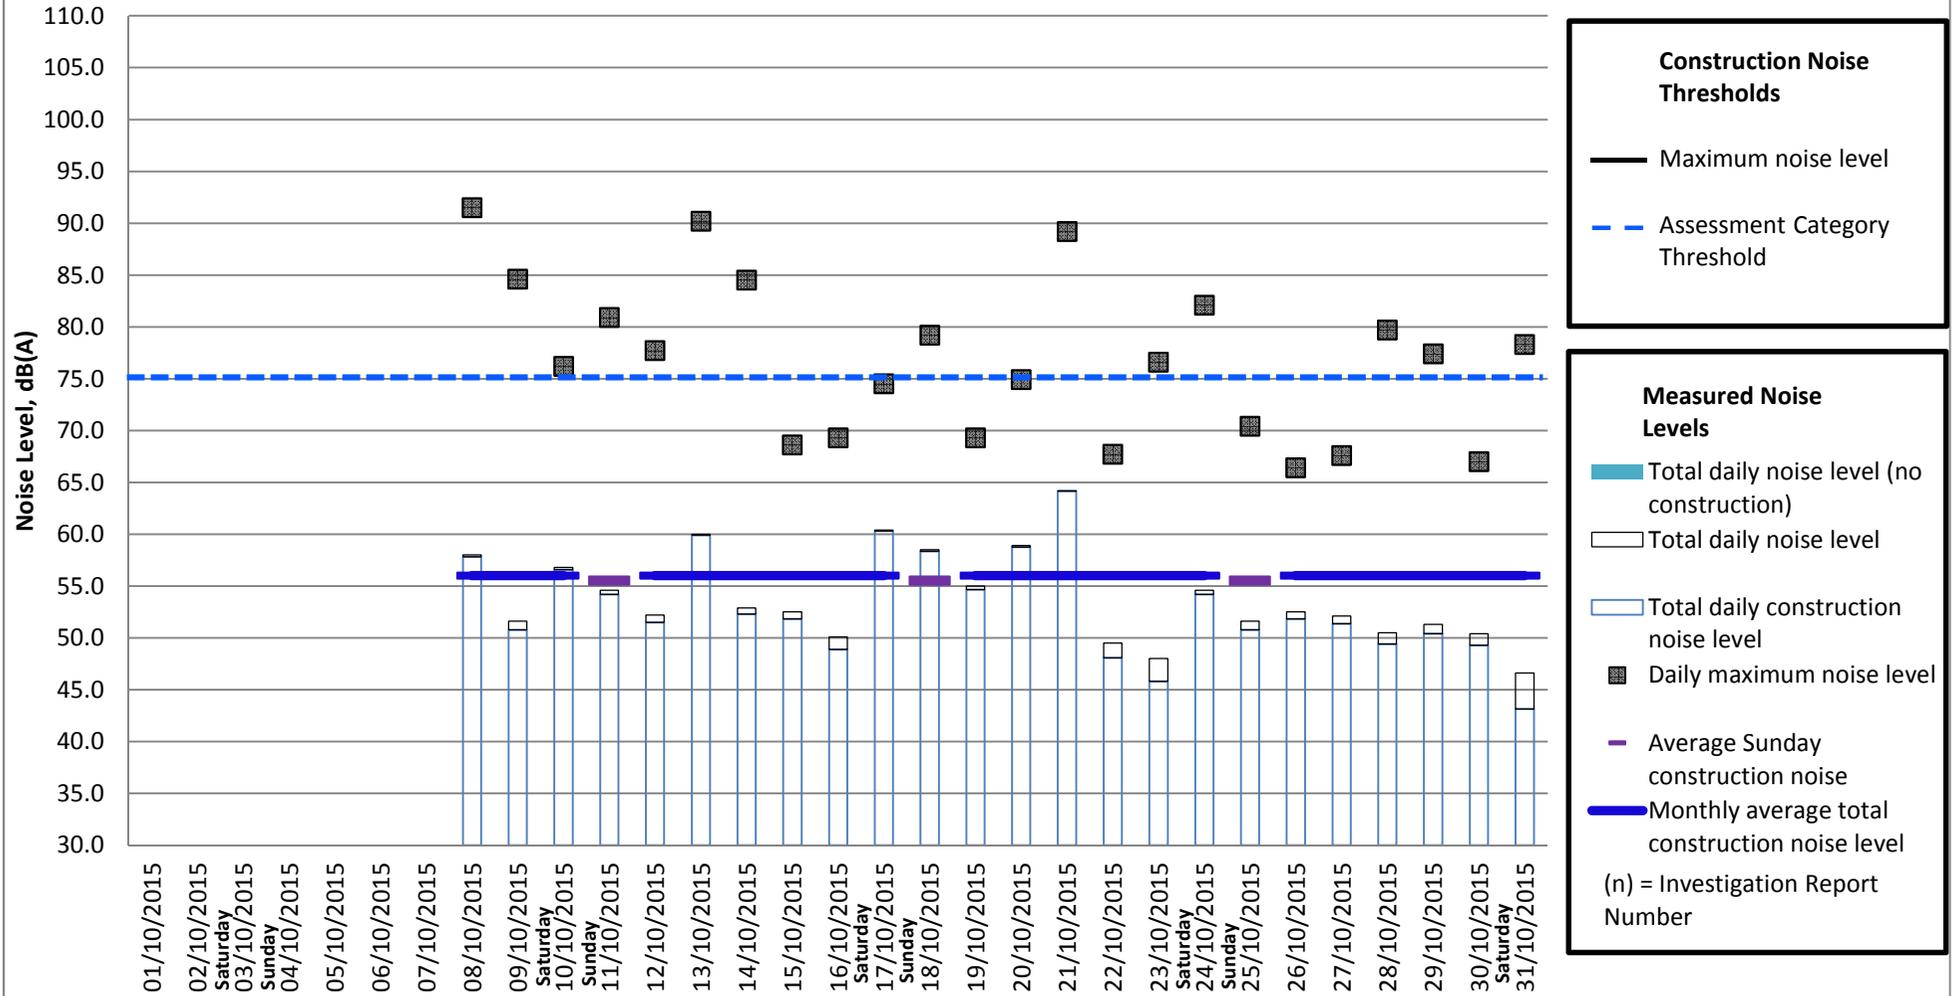

Note: There is no data before 08/10/2015 due to a problem with the monitor